

AD-A069 205










NEW JERSEY STATE DEPT OF ENVIRONMENTAL PROTECTION TRENTON F/G 13/2
NATIONAL DAM SAFETY PROGRAM. SWARTSWOOD LAKE DAM (NJ00171), DEL--ETC(U)
MAY 79 D J LEARY

DACW61-78-C-0124

NL


UNCLASSIFIED

         1 OF
AD
A069205



END
DATE
FILMED
7-79

DDC

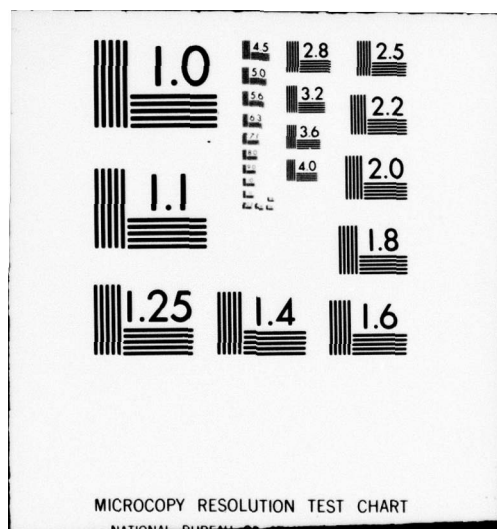



DELAWARE RIVER BASIN
BRANCH OF PAULINS KILL
SUSSEX COUNTY
NEW JERSEY

LEVEL II

SWARTSWOOD LAKE DAM

NJ 00171

PHASE 1 INSPECTION REPORT NATIONAL DAM SAFETY PROGRAM



Approved for public release;
distribution unlimited

DGC FILE COPY

DEPARTMENT OF THE ARMY

Philadelphia District
Corps of Engineers
Philadelphia, Pennsylvania

D D C
RECEIVED
JUN 1 1979
RELIED
D

May, 1979

DISCLAIMER NOTICE

**THIS DOCUMENT IS BEST QUALITY
PRACTICABLE. THE COPY FURNISHED
TO DDC CONTAINED A SIGNIFICANT
NUMBER OF PAGES WHICH DO NOT
REPRODUCE LEGIBLY.**

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER NJ00171	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Phase I Inspection Report National Dam Safety Program Swartswood Lake Dam Sussex County, N.J.		5. TYPE OF REPORT & PERIOD COVERED 9 FINAL rept.
6. AUTHOR(s) Dennis J. Leary P.E.		6. PERFORMING ORG. REPORT NUMBER
7. PERFORMING ORGANIZATION NAME AND ADDRESS Langan Engineering Assoc. Inc. 970 Clifton Ave. Clifton, New Jersey 07013		8. CONTRACT OR GRANT NUMBER(s) DACW61-78-C-0124
9. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Engineer District, Philadelphia Custom House, 2d & Chestnut Streets Philadelphia, Pennsylvania 19106		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBER 12 82p.
11. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE May 79
		13. NUMBER OF PAGES 75
		14. SECURITY CLASS. (of this report) Unclassified
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the Abstract) 6 National Dam Safety Program. Swartswood Lake Dam (NJ00171), Delaware River Basin, Basin, Branch of Paulins Kill, Sussex County, New Jersey. Phase I Inspection Report.		
18. SUPPLEMENTARY NOTES Copies are obtainable from National Technical Information Service, Springfield, Virginia, 22151.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dams Spillway Structural Analysis Safety Visual Inspection National Dam Inspection Act Report Safety Swartswood Lake Dam, N.J.		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report cites results of a technical investigation as to the dam's adequacy. The inspection and evaluation of the dam is as prescribed by the National Dam Inspection Act, Public Law 92-367. The technical investigation includes visual inspection, review of available design and construction records, and preliminary structural and hydraulic and hydrologic calculations, as applicable. An assessment of the dam's general condition is included in the report.		

DD FORM 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE

410891

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

NOTICE

**THIS DOCUMENT HAS BEEN REPRODUCED
FROM THE BEST COPY FURNISHED US BY
THE SPONSORING AGENCY. ALTHOUGH IT
IS RECOGNIZED THAT CERTAIN PORTIONS
ARE ILLEGIBLE, IT IS BEING RELEASED
IN THE INTEREST OF MAKING AVAILABLE
AS MUCH INFORMATION AS POSSIBLE.**



IN REPLY REFER TO

NAPEN-D

DEPARTMENT OF THE ARMY
PHILADELPHIA DISTRICT, CORPS OF ENGINEERS
CUSTOM HOUSE--2 D & CHESTNUT STREETS
PHILADELPHIA, PENNSYLVANIA 19106

ADDRESS TO	
DTIC	Write Section <input checked="" type="checkbox"/>
DDC	Dist Section <input type="checkbox"/>
UNANNOUNCED <input type="checkbox"/>	
JUSTIFICATION	
BY	
DISTRIBUTION/AVAILABILITY CODES	
Dist.	AVAIL. and/or SPECIAL
A	23 CP

Honorable Brendan T. Byrne
Governor of New Jersey
Trenton, NJ 08621

15 MAY 1979

Dear Governor Byrne:

Inclosed is the Phase I Inspection Report for Swartswood Lake Dam in Sussex County, New Jersey which has been prepared under authorization of the Dam Inspection Act, Public Law 92-367. A brief assessment of the dam's condition is given in the front of the report.

Based on visual inspection, available records, calculations and past operational performance, Swartswood Lake Dam, initially listed as a high hazard potential structure but reduced to a significant hazard potential structure as a result of this inspection, is judged to be in poor overall condition. The dam's spillway is considered inadequate since 17 percent of the Probable Maximum Flood would overtop the dam. To insure adequacy of the structure, the following actions, as a minimum, are recommended:

- a. The spillway's adequacy should be determined by a qualified professional consultant engaged by the owner using more sophisticated methods, procedures, and studies within six months from the date of approval of this report. Any remedial measures necessary to insure the adequacy of the spillway and to prevent overtopping should be initiated within calendar year 1980.
- b. Within six months from the date of approval of this report, engineering studies and analyses should be performed to determine the condition and structural stability of the dam and its foundation and abutments; including the spillway and low level outlet structure. This should include test borings to determine material properties relative to stability and seepage and installation of piezometers to facilitate seepage studies. Any remedial measures found necessary should be initiated

NAPEN-D

Honorable Brendan T. Byrne

within calendar year 1980.

c. Within three months from the date of approval of this report, the following actions should be completed:

(1) Reline or replace the 3.5 foot diameter cast iron low level outlet pipe and relocate the intake structure or provide an inlet channel to make the low level outlet system functional.

(2) Remove all trees and brush from the dam and abutment.

d. Within six months from the date of approval of this report, the following actions should be taken:

(1) The spillway channel masonry sidewalls and the walls along the downstream face of the dam should be repaired and, if necessary, strengthened.

(2) The erosion at the downstream side of the right abutment should be repaired.

(3) The hole at the downstream toe of the dam should be filled.

(4) Debris and fallen trees should be cleared from the downstream channel and, where necessary, the eroded channel banks should be repaired.

(5) Operate the repaired low level outlet regularly, at least two times a year, to ensure the operational condition of the gate.

NAPEN-D


Honorable Brendan T. Byrne

A copy of the report is being furnished to Mr. Dirk C. Hofman, New Jersey Department of Environmental Protection, the designated State Office contact for this program. Within five days of the date of this letter, a copy will also be sent to Congressman James A. Courter of the Thirteenth District. Under the provision of the Freedom of Information Act, the inspection report will be subject to release by this office, upon request, five days after the date of this letter.

Additional copies of this report may be obtained from the National Technical Information Services (NTIS), Springfield, Virginia 22161 at a reasonable cost. Please allow four to six weeks from the date of this letter for NTIS to have copies of the report available.

An important aspect of the Dam Safety Program will be the implementation of the recommendations made as a result of the inspection. We accordingly request that we be advised of proposed actions taken by the State to implement our recommendations.

Sincerely,

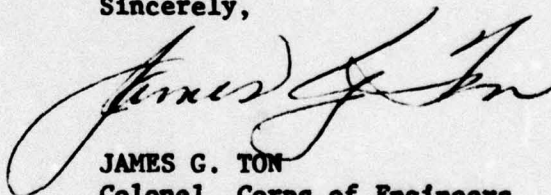

JAMES G. TON
Colonel, Corps of Engineers
District Engineer

1 Incl
As stated

Copies furnished:

Dirk C. Hofman, P.E., Deputy Director
Division of Water Resources
N. J. Dept. of Environmental Protection
P. O. Box CN029
Trenton, NJ 08625

John O'Dowd, Acting Chief
Bureau of Flood Plain Management
Division of Water Resources
N. J. Dept. of Environmental Protection
P. O. Box CN029
Trenton, NJ 08625

SWARTSWOOD LAKE DAM (NJ00171)

CORPS OF ENGINEERS ASSESSMENT OF GENERAL CONDITIONS

This dam was inspected on 12 and 20 December 1978 by Langan Engineering Associates Inc. under contract to the State of New Jersey. The State, under agreement with the U. S. Army Engineer District, Philadelphia, had this inspection performed in accordance with the National Dam Inspection Act, Public Law 92-367.

Swartswood Lake Dam, initially listed as a high hazard potential structure but reduced to a significant hazard potential structure as a result of this inspection, is judged to be in poor overall condition. The dam's spillway is considered inadequate since 17 percent of the Probable Maximum Flood would overtop the dam. To insure adequacy of the structure, the following actions, as a minimum, are recommended:

a. The spillway's adequacy should be determined by a qualified professional consultant engaged by the owner using more sophisticated methods, procedures, and studies within six months from the date of approval of this report. Any remedial measures necessary to insure the adequacy of the spillway and to prevent overtopping should be initiated within calendar year 1980.

b. Within six months from the date of approval of this report, engineering studies and analyses should be performed to determine the condition and structural stability of the dam and its foundation and abutments; including the spillway and low level outlet structure. This should include test borings to determine material properties relative to stability and seepage and installation of piezometers to facilitate seepage studies. Any remedial measures found necessary should be initiated within calendar year 1980.

c. Within three months from the date of approval of this report, the following actions should be completed:

(1) Reline or replace the 3.5 foot diameter cast iron low level outlet pipe and relocate the intake structure or provide an inlet channel to make the low level outlet system functional.

(2) Remove all trees and brush from the dam and abutment.

d. Within six months from the date of approval of this report, the following actions should be taken:

(1) The spillway channel masonry sidewalls and the walls along the downstream face of the dam should be repaired and, if necessary, strengthened.

(2) The erosion at the downstream side of the right abutment should be repaired.

(3) The hole at the downstream toe of the dam should be filled.

(4) Debris and fallen trees should be cleared from the downstream channel and, where necessary, the eroded channel banks should be repaired.

(5) Operate the repaired low level outlet regularly, at least two times a year, to ensure the operational condition of the gate.

APPROVED:


JAMES G. TOM

Colonel, Corps of Engineers
District Engineer

DATE:

11 May 1979

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

NAME OF DAM:	SWARTSWOOD LAKE DAM
ID NUMBER:	FED Id. No. NJ00171
STATE LOCATED:	NEW JERSEY
COUNTY LOCATED:	SUSSEX
STREAM:	BRANCH OF PAULINS KILL
RIVER BASIN:	DELAWARE
DATE OF INSPECTION:	DECEMBER 1978


ASSESSMENT OF GENERAL CONDITIONS

Swartswood Lake Dam is 76 years old and in what appears to be poor overall condition. There is no engineering data concerning the dam and its foundation materials. The low level outlet has rusted and is not functional. There is a possibility that portions of the dam are natural ground with variable and uncertain engineering properties. There are trees growing on the dam with roots that have likely penetrated the entire cross section. Portions of the masonry has deteriorated at downstream face of both abutments and along the sidewalls of the spillway. Trees and other vegetal debris are clogging the downstream channel. The upstream side of the low level outlet is clogged. The spillway capacity as determined by CE Screening criteria is inadequate. We estimate the dam can adequately pass only 16% of the PMF.

We recommend to reline or replace the 3.5-ft-dia CI low level outlet pipe and relocate the intake structure or provide inlet channel to make the low level outlet system functional. This should be done very soon. The entire dam and its

foundation and abutments; including the spillway and low level outlet structure should be investigated by means of borings and tests, and piezometers should be used to measure water levels within the dam. The results of the investigation should provide engineering properties of the materials for use in stability analyses. Remove all trees and brush and their roots from the dam and abutment. It is recognized that this is likely to be not only a difficult procedure but that it may endanger the entire dam unless it is properly done. The spillway channel masonry sidewalls and the walls along the downstream face of the dam should be repaired and if necessary, strengthened. The erosion at the downstream side of the right abutment should be repaired. The hole at the downstream toe of the dam should be filled. The above recommended measures should be done soon. Debris and fallen trees should be cleared from downstream channel and where necessary, the erosion of the channel banks should be repaired. This should be done in the near future.

The actual capacity of the spillway should be determined using more precise and sophisticated methods and procedures. The need for and type of mitigating measures should be determined. Around the clock surveillance during periods of unusually heavy precipitation should be provided, and a warning system established. This should be done soon. Operate the repaired low level outlet regularly, at least two times a year, to ensure the operational condition of the gate. This should be done regularly in the future.

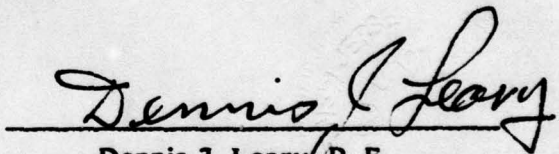
Dennis J. Leary, P. E.




OVERVIEW
SWARTSWOOD LAKE DAM

13 December 1978

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

NAME OF DAM:	SWARTSWOOD LAKE DAM
ID NUMBER:	FED Id. No. NJ00171
STATE LOCATED:	NEW JERSEY
COUNTY LOCATED:	SUSSEX
STREAM:	BRANCH OF PAULINS KILL
RIVER BASIN:	DELAWARE
DATE OF INSPECTION:	DECEMBER 1978

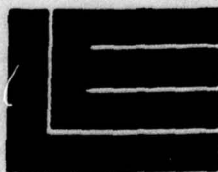

LANGAN ENGINEERING ASSOCIATES, INC.

Consulting Civil Engineers

**990 CLIFTON AVENUE
CLIFTON, NEW JERSEY**

201-472-9366

CONTENTS

NATIONAL DAM SAFETY REPORT

SWARTSWOOD LAKE DAM FED ID No. NJ00171

	<u>PAGE</u>
PREFACE	
SECTION 1 PROJECT INFORMATION	
1.1 <u>General</u>	1
1.2 <u>Project Description</u>	1
1.3 <u>Pertinent Data</u>	2
SECTION 2 ENGINEERING DATA	
2.1 <u>Introduction</u>	4
2.2 <u>Regional Geology</u>	4
SECTION 3 VISUAL INSPECTION	6
SECTION 4 OPERATIONAL PROCEDURES	7
SECTION 5 HYDRAULIC/HYDROLOGIC	7
SECTION 6 STRUCTURAL STABILITY	7
SECTION 7 ASSESSMENT, RECOMMENDATIONS/ REMEDIAL MEASURES	
7.1 <u>Assessment</u>	8
7.2 <u>Recommendations/Remedial Measures</u>	8
FIGURES	
1. Regional Vicinity Map	
2. Essential Project Features	
3. Regional Geologic Features	
APPENDICES	
1. Historical Summary	
2. Check List Visual Inspection	
3. Photographs	
4. Hydrologic Computations	
5. References	

PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation, and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that unsafe conditions be detected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. The test flood provides a measure of relative spillway capacity and serves as an aide in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

SECTION 1 PROJECT INFORMATION

1.1 General

Authority to perform the Phase I Safety Inspection of Swartswood Lake Dam was received from the State of New Jersey, Department of Environmental Protection, Division of Water Resources by letter dated 20 November 1978. This Authority was given pursuant to the National Dam Inspection Act, Public Law 92-367 and by agreement between the State and the US Army Engineers District, Philadelphia.

The purpose of the Phase I Investigation is to develop an assessment of the general conditions with respect to safety of Swartswood Lake Dam and appurtenances based upon available data and visual inspection, and determine any need for emergency measures and conclude if additional studies, investigations and analyses are necessary and warranted. The assessment is made using screening criteria established in Recommended Guidelines for Safety Inspection of Dams prepared by the Department of Army, Office of the Chief of Engineers. It is not the purpose of the inspection to imply that a dam meeting or failing to meet the screening criteria, is per se, certainly adequate or inadequate.

1.2 Project Description

Swartswood Lake Dam is a 76-year-old, 100-ft-long, 16-ft-high earth dam. The downstream slope is vertical with stone facing and the width of the crest is at least 20 ft. There is a rock filled timber-crib overfall spillway upstream of the center of the dam. It is about 50-ft-long and its crest is about three feet below the top of the dam. The overfall is about 12-ft to a concrete apron that extends from the toe of the spillway to the downstream face of the dam. The crest of the spillway is reported to be 9-ft-wide with 6-ft of concrete slab on the top of the timber crib. There is 3.5-ft-dia low level outlet pipe passing through the right side of the dam. There is a 15-ft-wide wood bridge along the top of the dam. It lies over the spillway discharge apron and is about 15-ft downstream from the spillway. A historic mill house is located at the downstream side of the right abutment. The old mill brook runs approximately parallel to the spillway discharge channel and merges with it about 400 feet downstream.

The dam is located at the south end of Swartswood Lake east of W. Shore Drive in Stillwater Township, Sussex County, N.J. It is at north latitude $41^{\circ} 3.6'$ and west longitude $74^{\circ} 51.2'$. A regional vicinity map is given in Fig 1 and essential project features are given in Fig 2.

Swartswood Dam is classified as being "Intermediate" on the basis of its maximum reservoir storage volume of 5860 acre-feet which is more than 1,000 - acre feet, but less than 50,000-acre feet. It is classified as "Small" on the basis of its total height of about 16 ft which is less than 40 feet. The overall size classification is the larger of these two determinations, and accordingly the dam is classified as "Intermediate" in size.

In the National Inventory of Dams, Swartwood Lake Dam has been classified as having "High Hazard Potential" on the basis that failure of the dam would cause excessive property damage to residences downstream, and could potentially cause more than a few deaths. Visual inspection of the downstream area shows that breach of the dam would cause little damage to residences which are located on high ground but could be hazardous to people utilizing low lying roads. Accordingly, it is proposed to change the Hazard Classification Potential to "Significant".

Swartwood Lake Dam is owned by the N.J. DEP Div. of Forests and Parks, Labor and Industry Bldg., Room 806, Box 1420, Trenton, N.J. 08625. The original purpose of the dam was for the operation of a now abandoned mill. Its present purpose is impoundment of Swartwood Lake so that its beauty and water level are maintained.

No essential information is available concerning the design of the dam and records indicate it was constructed by C.H. Crisman. No other essential information is available concerning the construction history of the dam. A historical summary of the dam and mill is given in Appendix 1.

There are no formal operating procedures for the dam. Park Rangers patrol the dam daily.

1.3 Pertinent Data

- | | | |
|----|--|--|
| a. | The Drainage area is | 17.2 sq mi |
| | The Lake Area is: | 516 acres |
| b. | Discharge at Dam Site | |
| | Maximum known flood at dam site: | Unknown |
| | Ungated spillway capacity at maximum pool elevation: | 866 cfs |
| | Total spillway capacity at maximum pool elevation: | 866 cfs |
| c. | Elevation * | |
| | Top dam: | Approx. Elev. 485 at embankment and bridge section, Low point at El. 484.17 downstream stone facing. |
| | Normal pool (assumed to be spillway crest): | Elev. 481.43 |

* All elevations are referenced to a benchmark elevation of 484.47 at the right embankment established by N.J. Geodetic Control Survey, Dept of Conservation BM Station 202. (See Fig 2).

Spillway crest:	Elev. 481.43
Streambed at centerline of dam:	Elev. 469.±
Maximum tailwater:	Approx. 471.5 at time of inspection
d. Reservoir	
Length of maximum pool:	Approx. 12050 feet
Length of normal pool:	Approx. 12000 feet
e. Storage (acre-feet)	
Normal pool:	4000 AF (estimated)
Top of dam:	5860 AF (estimated)
f. Reservoir Surface (acres)	
Top dam:	524 Acres
Maximum pool:	524 Acres
Recreation pool:	516 Acres (assumed to be same as spillway crest)
Spillway crest:	516 Acres
g. Dam	
Type:	Earth fill with masonry facing
Length:	100 feet ±
Height:	16 feet ±
Top width:	Approx. 15 feet at bridge 20 feet or more at two ends
Side slopes:	Vertical downstream; approx. 1V:10H upstream
Zoning:	None observed
Impervious core:	None observed
Cutoff:	None observed
Grout curtain:	None observed

h. Spillway

Type:

Overfall broad-crested weir with crest inclined slightly downward. Reported to be rock-filled timber-crib.

Length of Weir:

50 feet \pm

Crest elevation:

Elev. 481.43

U/S channel:

None observed

D/S channel:

Discharge under wood bridge

i. Regulating Outlets

3.5-ft-dia low level CI pipe through dam at right side of bridge. Sluice gate does not operate and upstream entrance to pipe is plugged. Access is from top of dam.

SECTION 2 ENGINEERING DATA

2.1 Introduction

There is no essential information available concerning the design and construction of the dam. There are no operating procedures or records. An evaluation of engineering data cannot be made because of the lack of information.

2.2 Regional Geology

Swartswood Lake Dam is located in the Valley and Ridge Province. This province encompasses one-twelfth of the land area of the state - chiefly in Warren and Sussex Counties. It is characterized by a series of nearly parallel ridges and valleys that trend northeast-southwest. The ridges are underlain with northwest dipping Silurian and Devonian sandstones and conglomerates. The upper Delaware Valley is underlain with weak Devonian limestones and shales while the Kittatinny Valley is underlain with folded Cambrian and Ordovician limestones and shales. Kittatinny Mountain is the most prominent topographic feature and its nearly even crest averages 1600 to 1800 feet in elevation.

The Valley and Ridge Province is divided into western, middle, and eastern sections that include the Upper Delaware Valley, Kittatinny Mountain, and Kittatinny Valley. The Upper Delaware Valley encompasses the region west of Kittatinny Mountain that has been eroded in Devonian limestones and shales. Kittatinny Mountain makes up the middle section of the Province and forms the eastern border of the Upper Delaware Valley and the northwestern border of Kittatinny Valley. The ridge is underlain with the very resistant lower Silurian Shawangunk conglomerate and High Falls sandstone. The northeastern side is bordered by the escarpments of the Shawangunk conglomerate, which rise steeply from the Kittatinny Valley floor. The Shawangunk conglomerate has been extensively broken up into large rock fragments by mechanical weathering and frost action and forms mass wasted talus slopes along the ramparts of the eastern escarpment. These talus slopes are extensively developed in the Delaware Water Gap.

The Kittatinny Valley area is a broad northeast-southwest lowland where the Harrisburg Peneplain is well developed. The valley is 10 to 13 miles wide and lies between the New Jersey Highlands on the east and Kittatinny Mountain on the west. The Wisconsin ice sheet covered all of the Valley and Ridge Province and deposited a terminal moraine south of the province near Belvidere. Much of the land surface north of the terminal moraine consists of a thin sheet of glacial till and ice-scoured bedrock surfaces. In addition, fluvial deposits of stratified drift consisting of eskers, kames, kame terraces, and deltas mantle many of the areas of the valley bottoms. Discontinuous recessional moraines were deposited during stillstands in the ice retreat. These moraines now form a discontinuous low band of hills across nearly all of Sussex County.

Glacial till covers large areas of the Valley and Ridge Province. Generally the till is extremely thin and sometimes present only in patches or as scattered boulders. It is best developed on broad summits, interstream surfaces, and in low passes or cols, and is thinnest or absent on steep slopes, on narrow ridges, and in narrow valleys. The greatest thickness of the till in the Kittatinny Valley is over 100 feet just on the edge of the valley at Ogdensburg. Estimates of the thickness range from 8 to 10 feet along the west slope of Kittatinny Mountain; 2 to 3 feet along the crest of Kittatinny Mountain; 5 to 10 feet on the limestone belts of Kittatinny Valley; 8 to 12 feet on the shale belts of Kittatinny Valley; and from 5 to 20 feet in Vernon Valley. The composition of till is largely of local origin and reflects the character of the underlying rock. It is generally compact because of the high clay content derived from the weathered shales and has many resistant boulders of Shawangunk conglomerate as well as erratics derived from more distant sources.

Swartswood Lake is a basin lake produced by the obstruction of the river valley by glacial drift.

SECTION 3 VISUAL INSPECTION

Swartswood Lake Dam is an earth-fill dam with masonry facing. The broad crested overfall type spillway located at about the center of the dam is set back about 20 feet from the longitudinal axis of the dam. Water was flowing over the spillway with about 3-inch head at the time of our inspection. A clear inspection of the weir surface was not possible. However, at the right spillway/abutment junction, water was observed to flow over the weir at an angle, possibly due to the original design of the west masonry side wall.

The general alignment of the masonry structure appeared satisfactory. Some mortar cracks were observed on the downstream face. Loose stones were observed on both ends of the structure where it joins the abutments. Masonry at the downstream face of the left end of the dam appears to have been stacked up without any mortar or cement. No noticeable seepage was observed from any part of the structure. Erosion was observed at downstream side of structure/abutment junction near the north-east corner of the old mill house. Large trees are growing at the right side of the dam near the spillway suggesting that portions of the embankment could be natural ground.

A 3.5-ft-dia pipe exists under the right abutment side of the dam. The area in front of the intake structure is filled and the pipe does not appear to be in use at present.

Scattered homes and recreation communities are located at different areas around the lake. The side slopes vary from very flat to fairly steep. There are no signs of unstable slopes except localized minor erosion. Considerable amounts of sediment has been deposited adjacent and up to the spillway crest.

No homes were observed immediately downstream until the Village of Stillwater which is about 2½ miles away. Scattered homes are also located in the vicinity of the dam area but they are at high elevations.

Numerous leaves and debris exist on the downstream side of the dam. Fallen trees and debris have collected and formed a natural obstruction across the channel about 100 to 300 feet downstream. Occasional fallen trees partially lying across the channel were also observed between these two locations. The toe of the left bank near the dam appears to have been washed and eroded, exposing the roots of some trees.

The old mill brook is located at the right of the downstream channel. The mill brook runs approximately parallel to the channel and merges with it about 400 feet downstream. No flow was observed in the brook.

The visual inspection check list is given in Appendix 2 and photographs are given in Appendix 3.

SECTION 4 OPERATIONAL PROCEDURES

We have been informed that there are no operational procedures for the dam and facilities. The dam is patrolled daily by Park Rangers.

SECTION 5 HYDRAULIC/HYDROLOGIC

The hydraulic/hydrologic evaluation is based on a Spillway design Flood (SDF) equal to the full Probable Maximum Flood (PMF) chosen in accordance with the evaluation guidelines for dams classified as Significant Hazard and Intermediate in size. Hydrologic design data for this dam is not available. The PMF has been determined by developing a synthetic hydrograph based on the maximum probable precipitation of 22 inches (200 square mile - 24 hour). Hydrologic computations are presented in Appendix 4. The PMF peak inflow determined for the subject watershed is 14,755 cfs.

The capacity of the spillway at maximum pool elevation (El. 485) is 866 cfs which is significantly less than SDF.

Flood routing for the PMF indicates the dam will overtop by approximately 7.5 ft. For 1/2 PMF the same will overtop by approximately 3.7 feet. We estimate the dam can adequately pass only 16% of the PMF.

Drawdown of the reservoir has not been evaluated because the regulatory outlet is not operable when lake level is below spillway crest.

SECTION 6 STRUCTURAL STABILITY

No information is available concerning the engineering properties of the dam and foundation materials. We are not aware of any post construction changes or of any operating records. The fact the dam has existed for over 76 years is no indication that it will continue to do so.

It is our opinion the stability of Swartswood Lake Dam is marginal and should be considered to have less than conventional safety margins unless additional engineering analysis proves otherwise.

Swartswood Lake Dam is located in Seismic Zone 1 of the Seismic Zone Map of Contiguous States. The degree of stability of the dam and appurtenances is assumed to be less than adequate with respect to conventional safety margins under both static and earthquake loading.

SECTION 7 ASSESSMENT, RECOMMENDATIONS/REMEDIAL MEASURES

7.1 Assessment

Swartswood Lake Dam is 76 years old and in what appears to be poor overall condition. There is no engineering data concerning the dam and its foundation materials. The low level outlet has rusted and is not functional. There is a possibility that portions of the dam are natural ground with variable and uncertain engineering properties. There are trees growing on the dam with roots that have likely penetrated the entire cross section. Portions of the masonry has deteriorated at downstream face of both abutments and along the sidewalls of the spillway. Trees and other vegetal debris are clogging the downstream channel. The upstream side of the low level outlet is clogged.


The spillway capacity as determined by CE Screening criteria is inadequate. We estimate the dam can adequately pass only 16% of the PMF.

7.2 Recommendations and Remedial Measures

We recommend the following remedial measures:

1. Reline or replace the 3.5-ft-dia CI low level outlet pipe and relocate the intake structure or provide inlet channel to make the low level outlet system functional. This should be done very soon.
2. The entire dam and its foundation and abutments; including the spillway and low level outlet structure should be investigated by means of borings and tests, and piezometers should be used to measure water levels within the dam. The results of the investigation should provide engineering properties of the materials for use in stability analyses. This should be done soon.
3. Remove all trees and brush and if deemed necessary from further investigation, their roots from the dam and abutment. It is recognized that this is likely to be not only a difficult procedure but that it may endanger the entire dam unless it is properly done. This should be done soon.


4. The spillway channel masonry sidewalls and the walls along the downstream face of the dam should be repaired and if necessary strengthened. This should be done soon.
5. The erosion at the downstream side of the right abutment should be repaired. This should be done soon.
6. The hole at the downstream toe of the dam should be filled. This should be done soon.
7. Debris and fallen trees should be cleared from downstream channel and where necessary the erosion of the channel banks should be repaired. This should be done in the near future.
8. The spillway capacity as determined by CE Screening criteria is inadequate. We estimate the dam can adequately pass only 16% of the PMF. The actual capacity of the spillway should be determined using more precise and sophisticated methods and procedures. The need for and type of mitigating measures should be determined. Around the clock surveillance during periods of unusually heavy precipitation should be provided, and a warning system established. This should be done soon.
9. Operate the repaired low level outlet regularly, at least two times a year, to ensure the operational condition of the gate. This should be done regularly in the future.

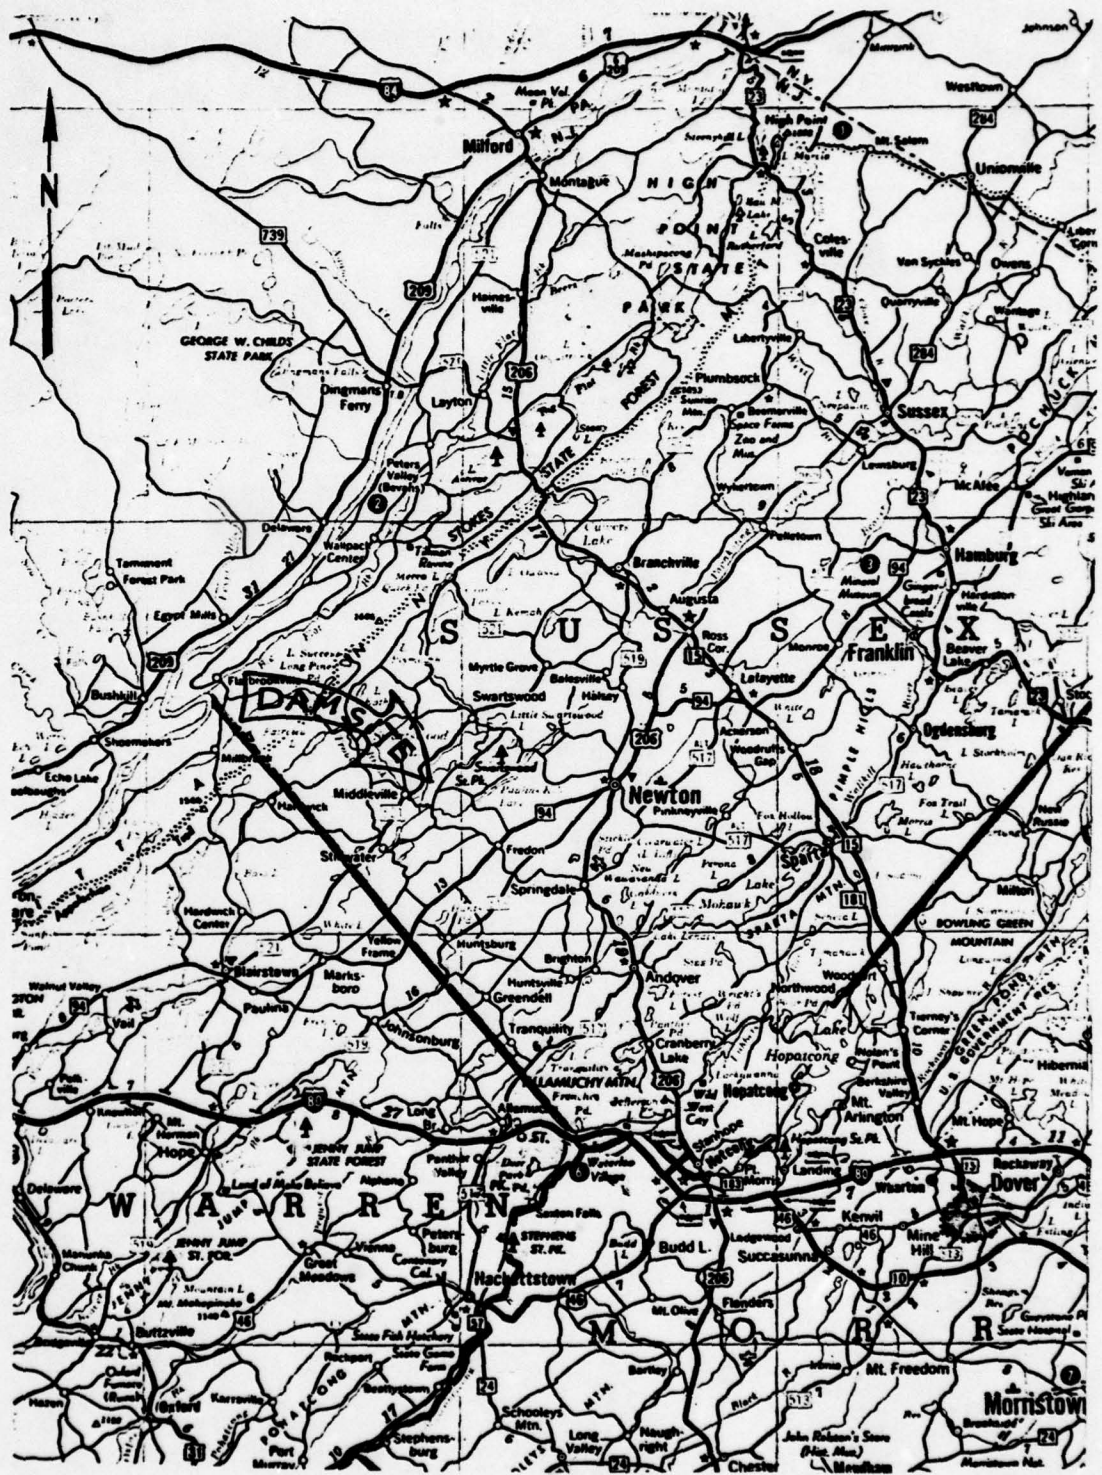

lin. \approx 5.2 mi

REGIONAL VICINITY MAP
SWARTSWOOD LAKE DAM

Fig. 1

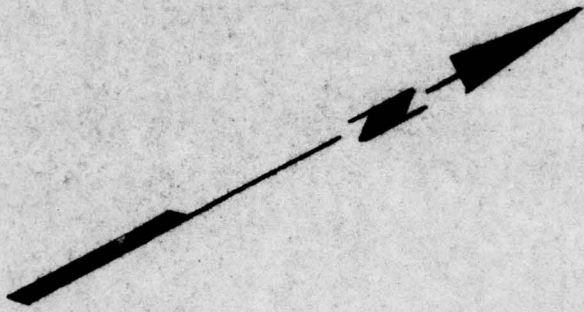

WEST SHORE DRIVE

485.88

484.92

484.92

486.31

481.81

488.30

485.18

+485.22

GATE
STEM

493.81


483.58

484.92

484.17


ABANDONED
MILL

B
473.22

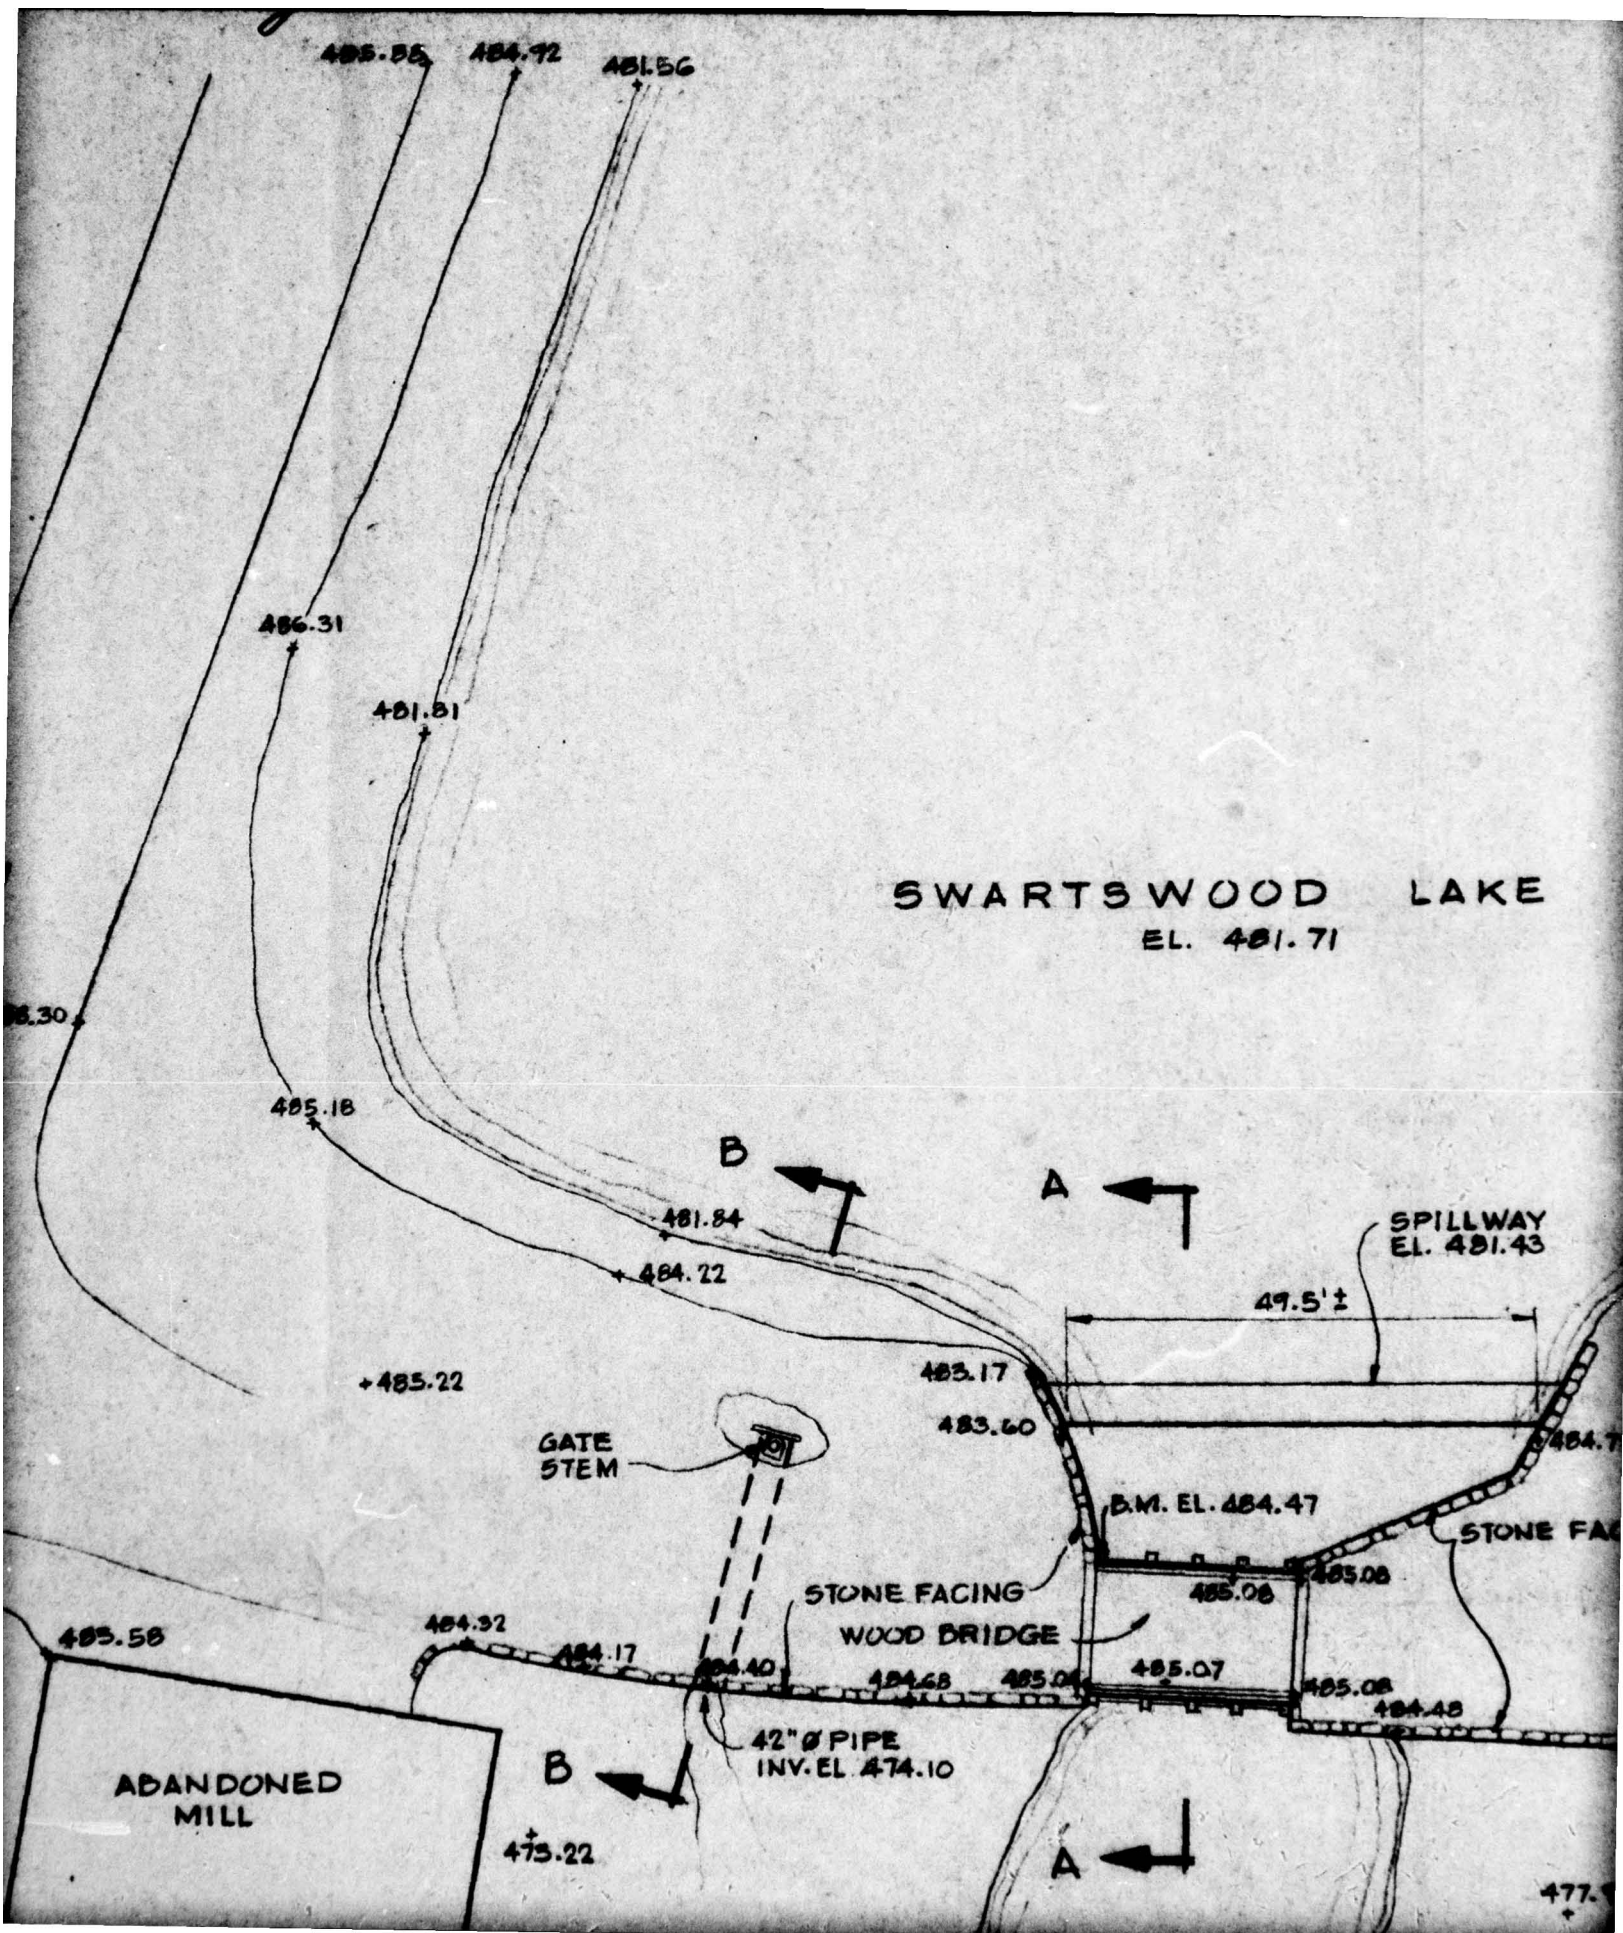


3

WOOD LAKE
EL. 481.71

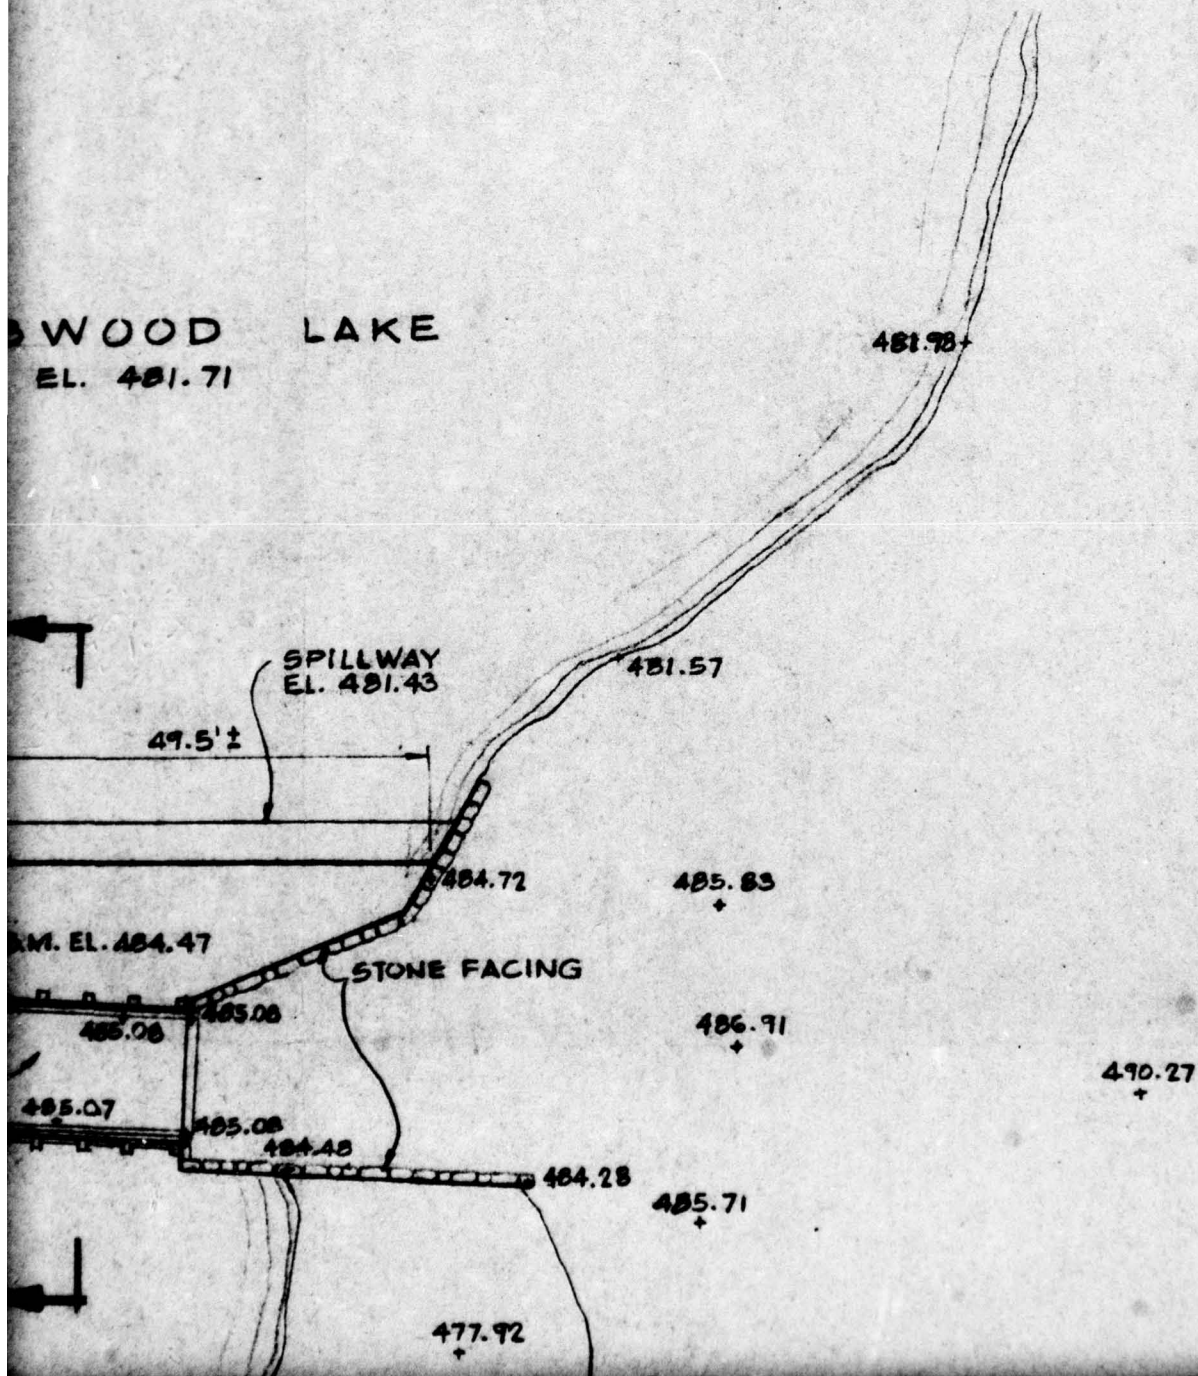

4

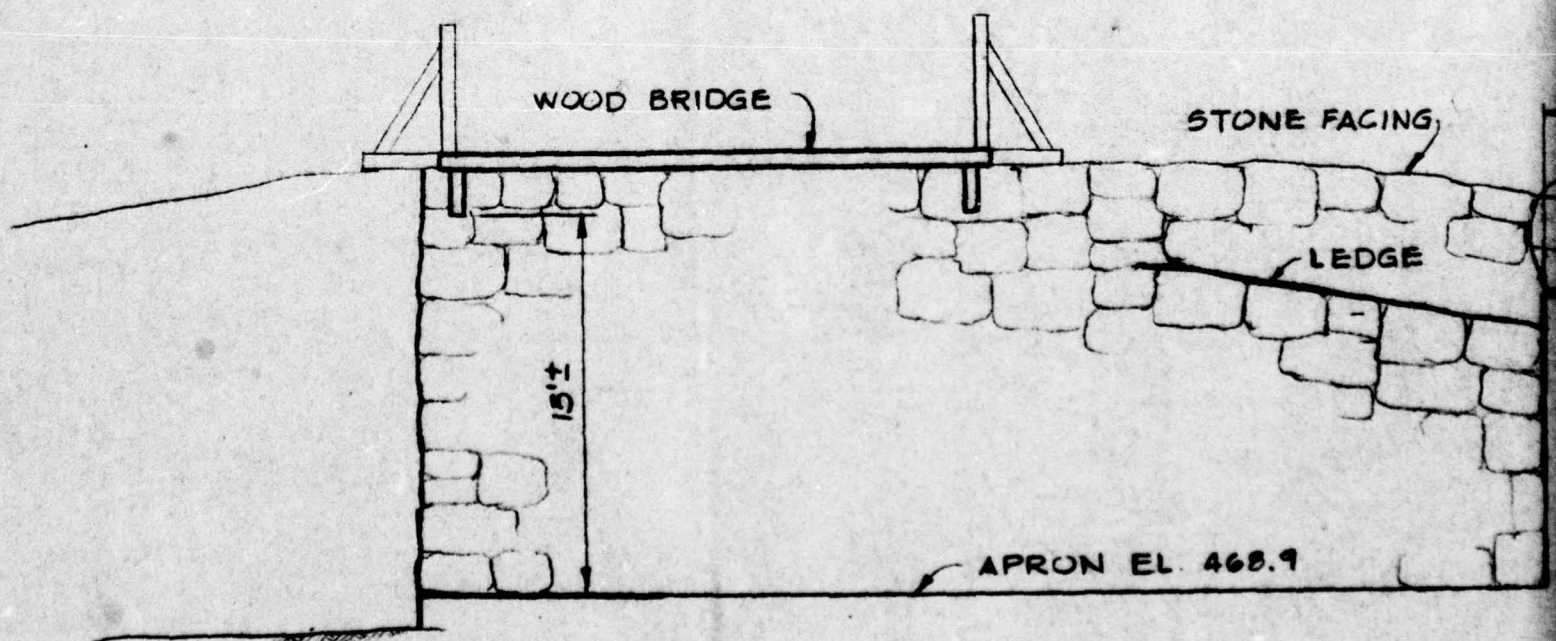


SECTION A-A

SCALE: 1" = 5'

5


493.81

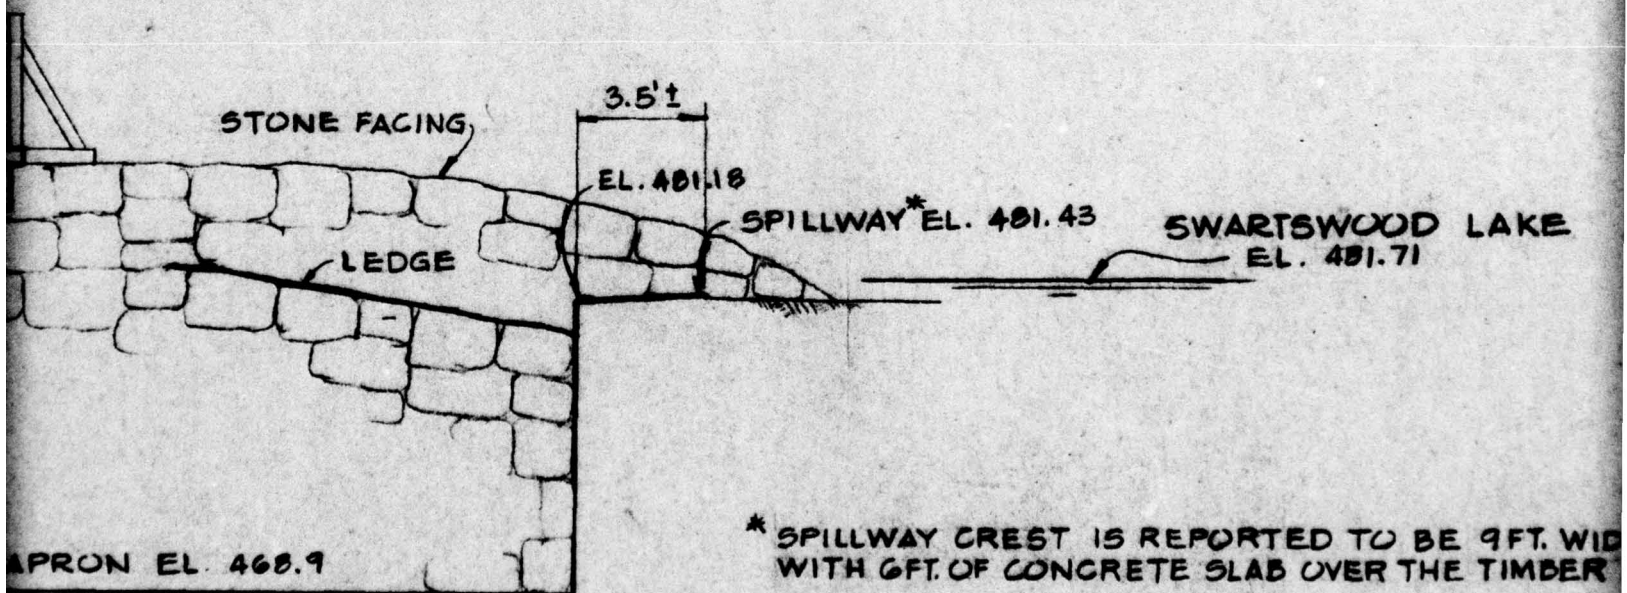


* SPILLWAY CREST IS REPORTED TO BE 9 FT. WID
WITH 6 FT. OF CONCRETE SLAB OVER THE TIMBER


ON A-A


1" = 5'

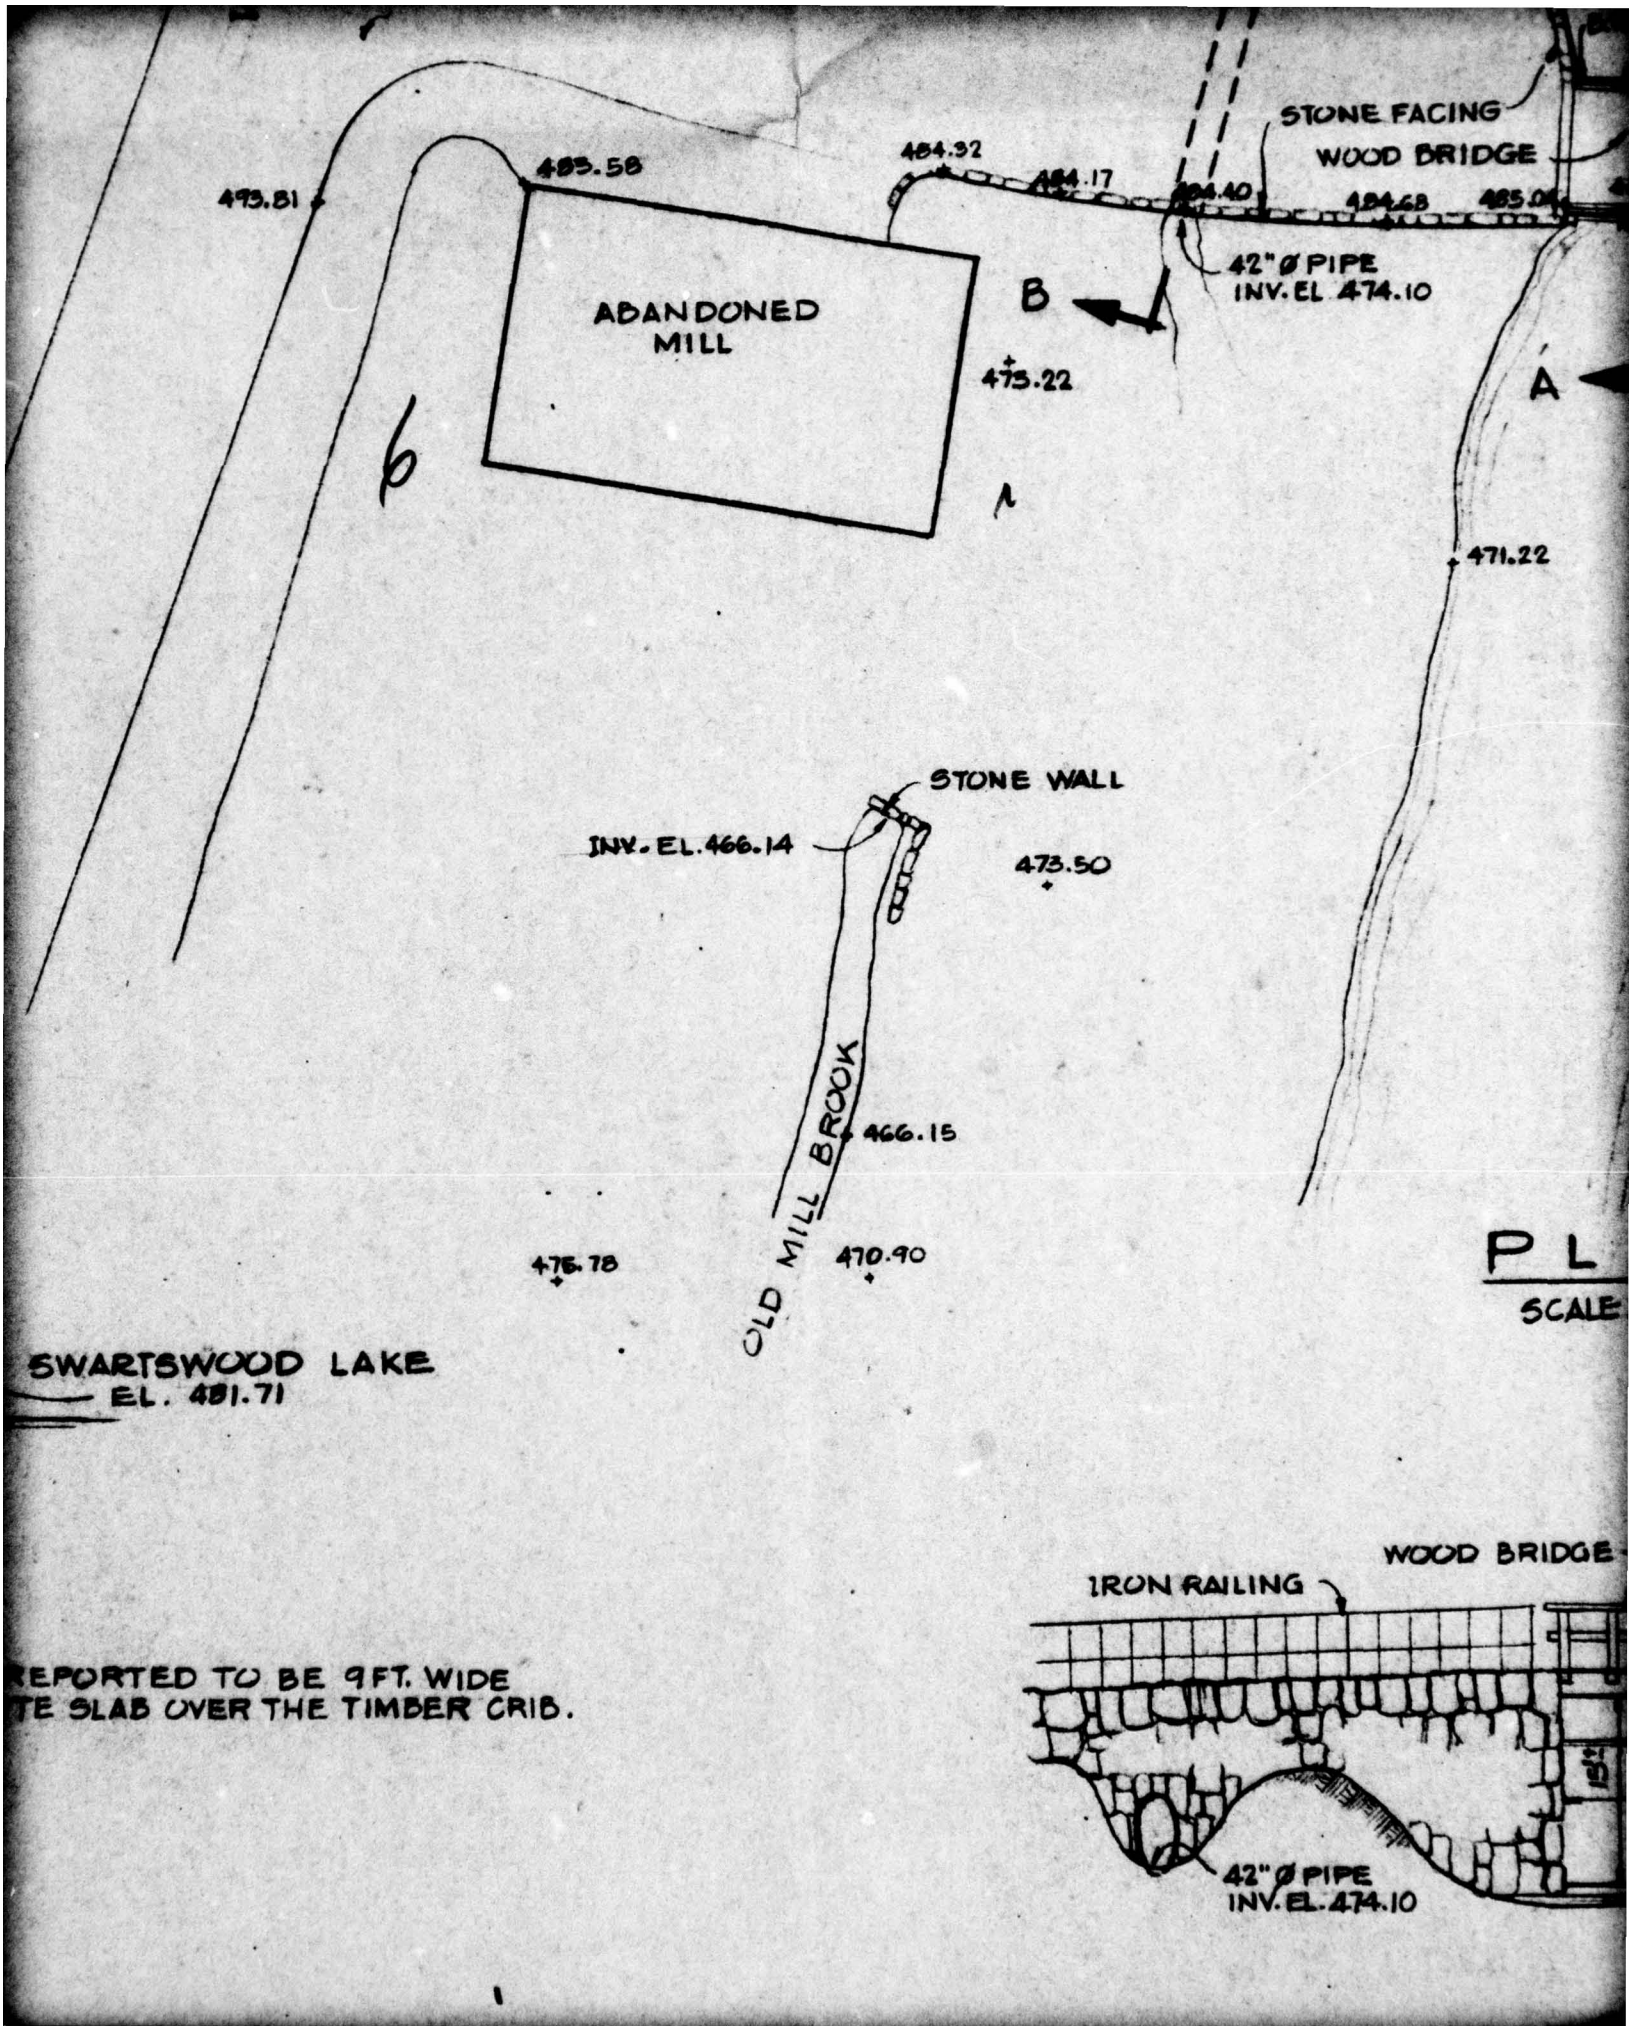

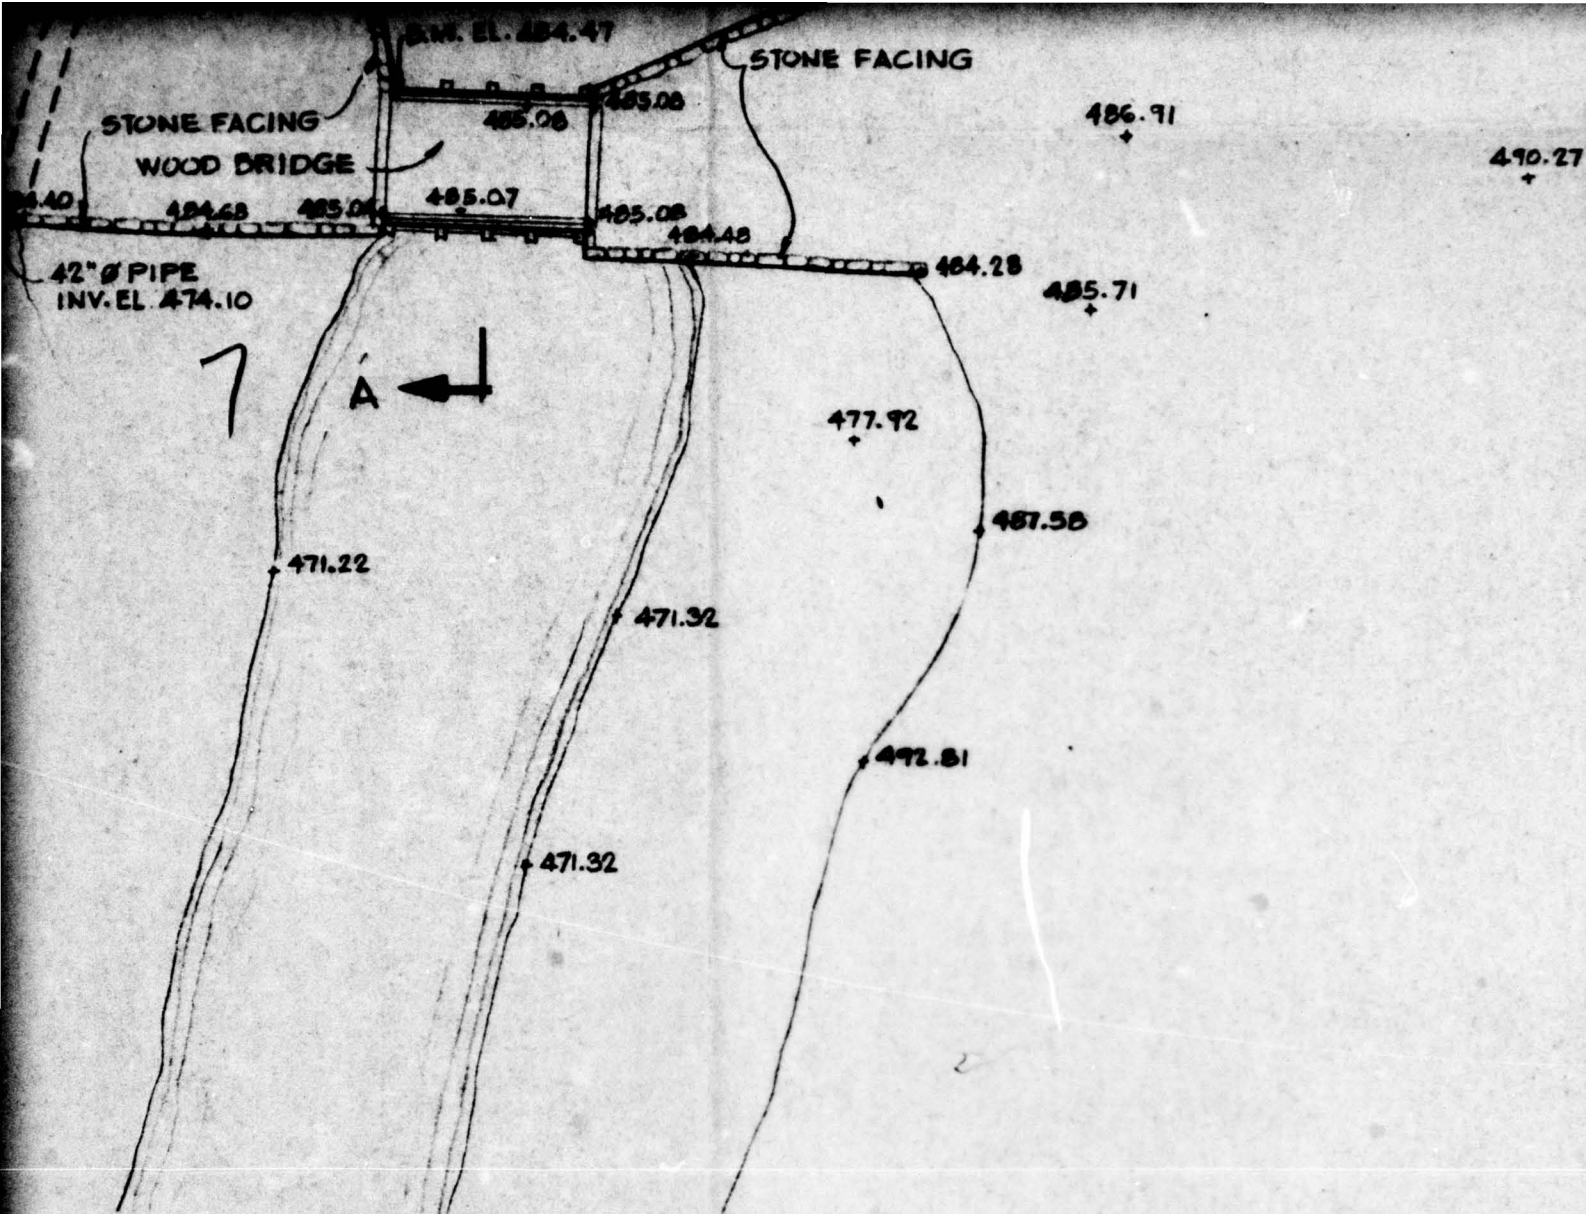


PLAN
SCALE: 1" = 20'

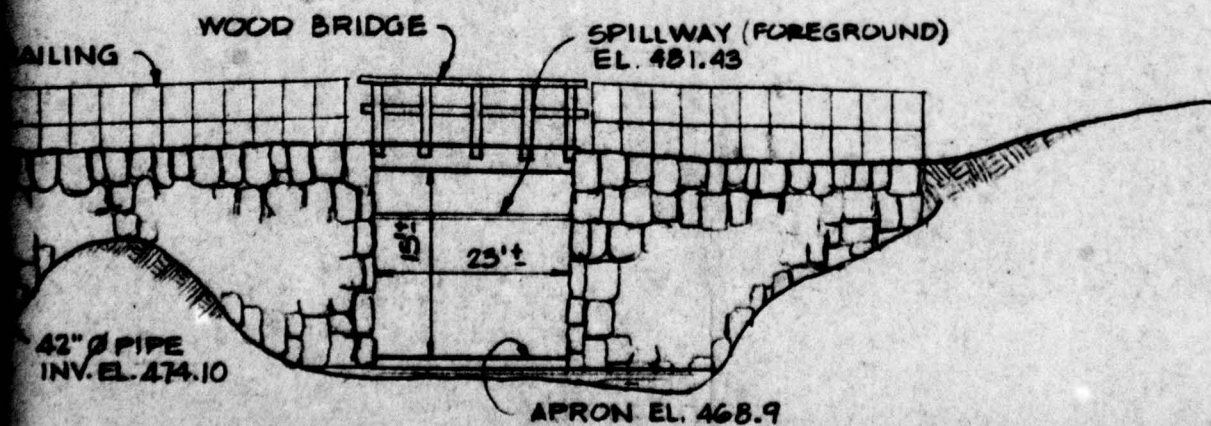

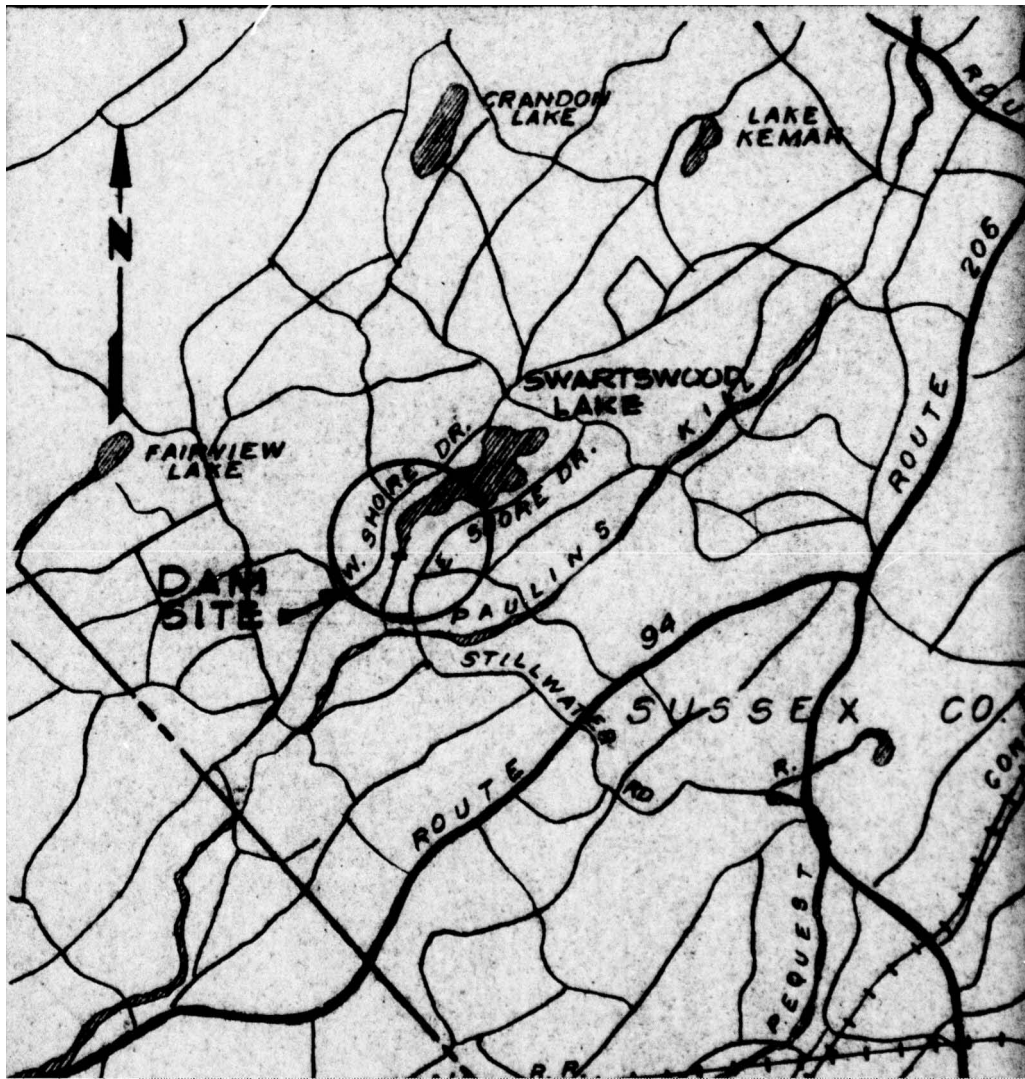

9

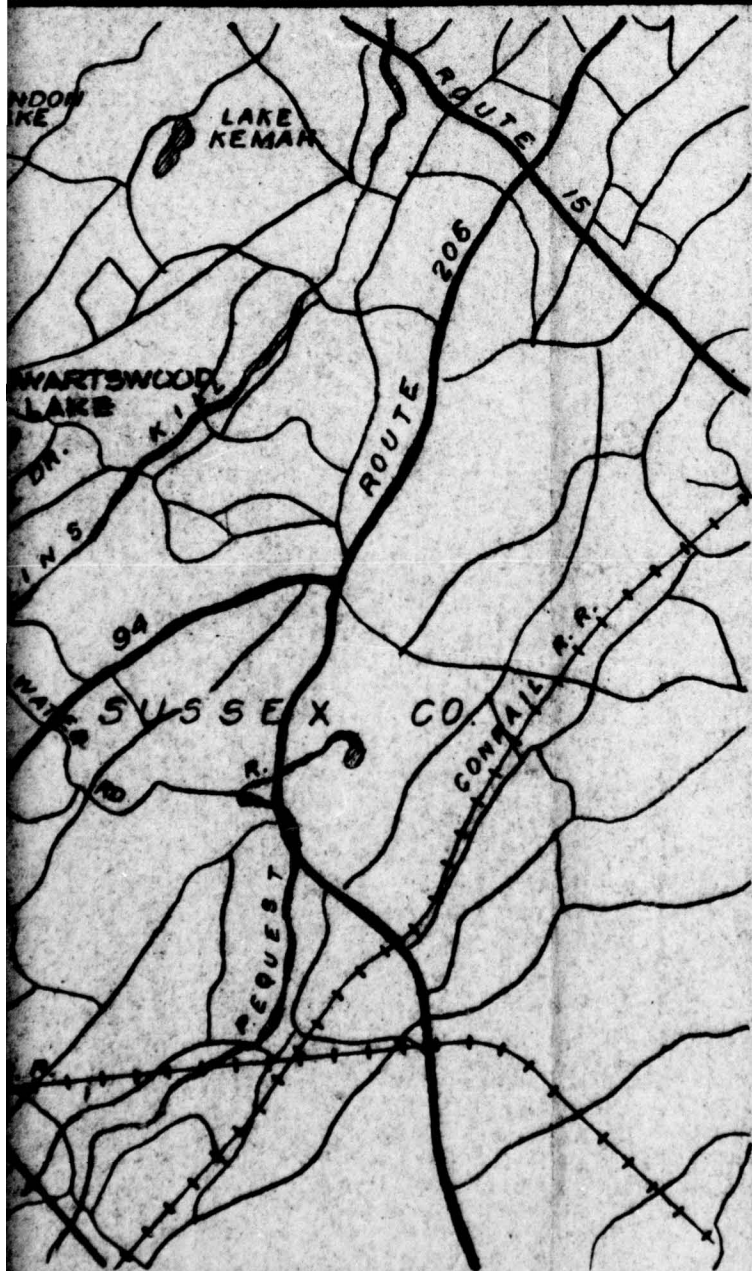

KEY PLAN


DATE

DESCRIPTION

NO.

REVISIONS

10

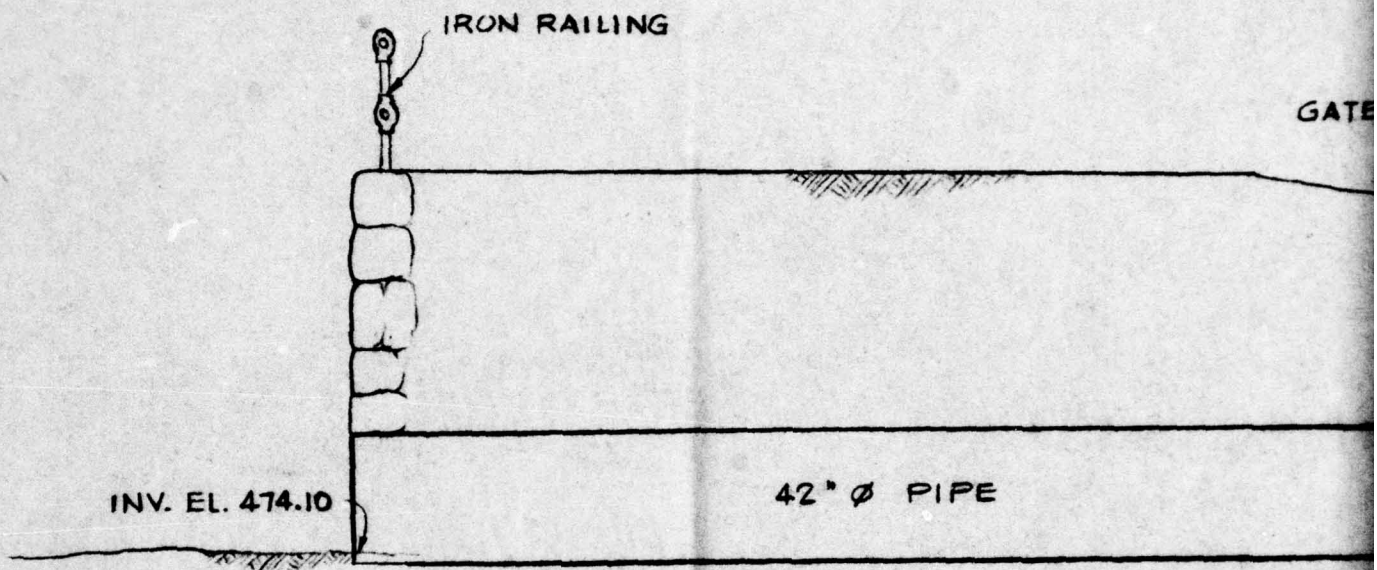

SECTION B-B

SCALE: 1" = 5'

11

NOTE: GATE AND TRASH RACK DO NOT APPEAR IN

GATE STEM


TRASH RACK

SWAR
EL. 481

PIPE

SECTION B-B


SCALE: 1" = 5'

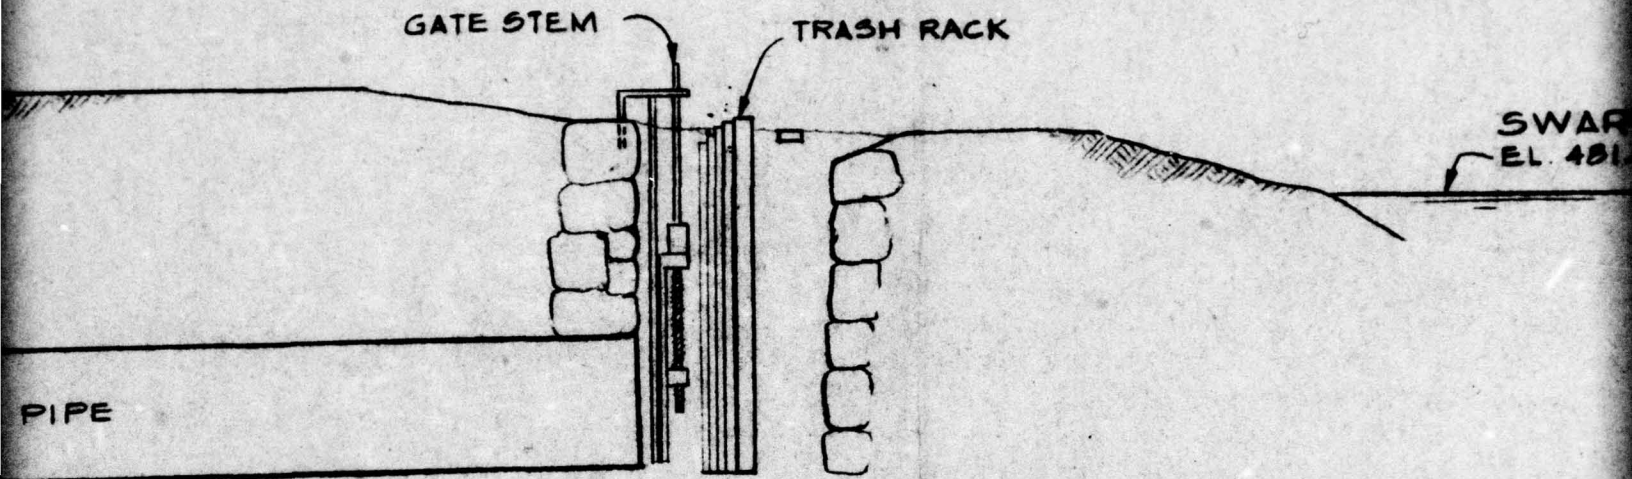


12

TRASH RACK DO NOT APPEAR IN USE.

SWARTSWOOD LAKE
EL. 481.71



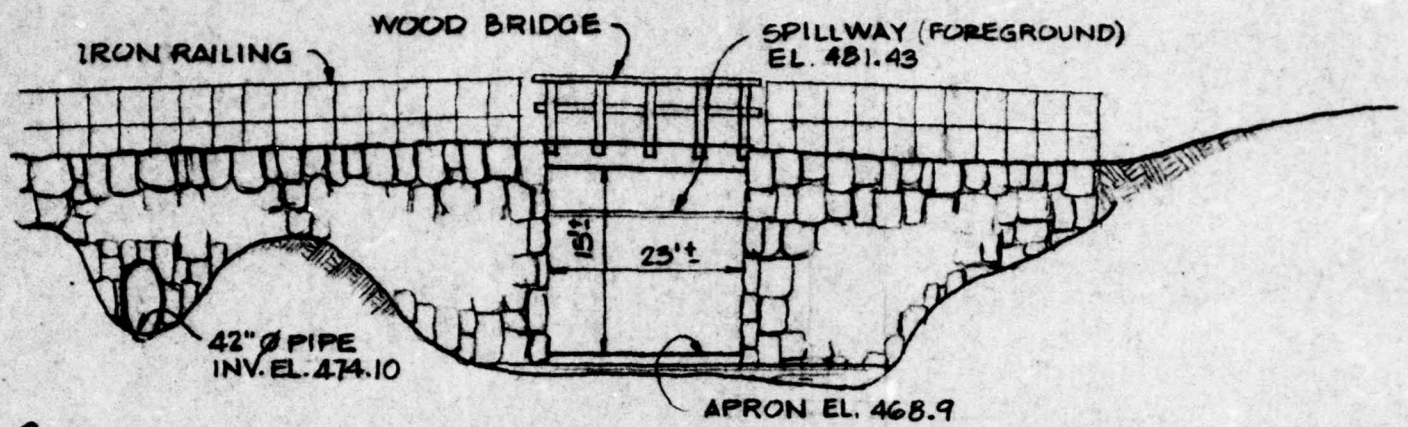

PROFILE (DOWNSTREAM)

SCALE: HORIZ: 1" = 20'
VERT: 1" = 10'

14

NOTE:

THE ELEVATIONS SHOWN WERE OBTAINED USING A SURVEYOR'S TRANSIT AND LEVEL AND A BENCHMARK ELEVATION OF 487.47 THAT WAS INDICATED ON THE SOUTHWEST CORNER OF THE WOOD BRIDGE AT THE SITE. THESE ELEVATIONS ARE APPROXIMATE. INFORMATION SHOWN BELOW GROUND SURFACE AND WATER LEVEL HAVE NOT BEEN CONFIRMED.

PROJ

INS

N

DRAW

SW

F

F

JOB N

DATE

SCALE

DRN

CHRS

LS



IED USING A SURVEYOR'S
ELEVATION OF 487.47 THAT
R OF THE WOOD BRIDGE
APPROXIMATE.
FACE AND WATER LEVEL

PROJECT

PHASE I
INSPECTION & EVALUATION
NEW JERSEY DAMS

DRAWING TITLE

SWARTSWOOD LAKE DAM

FEBRUARY 1979
FED. I.D. NO. NJ 00171

JOB NO.

J - 785B

DATE

26. FEB 1979

SCALE

AS NOTED

DRN. BY


J. R.

CHKD. BY

D. J. L.

DRAWING NO.

FIG. 2

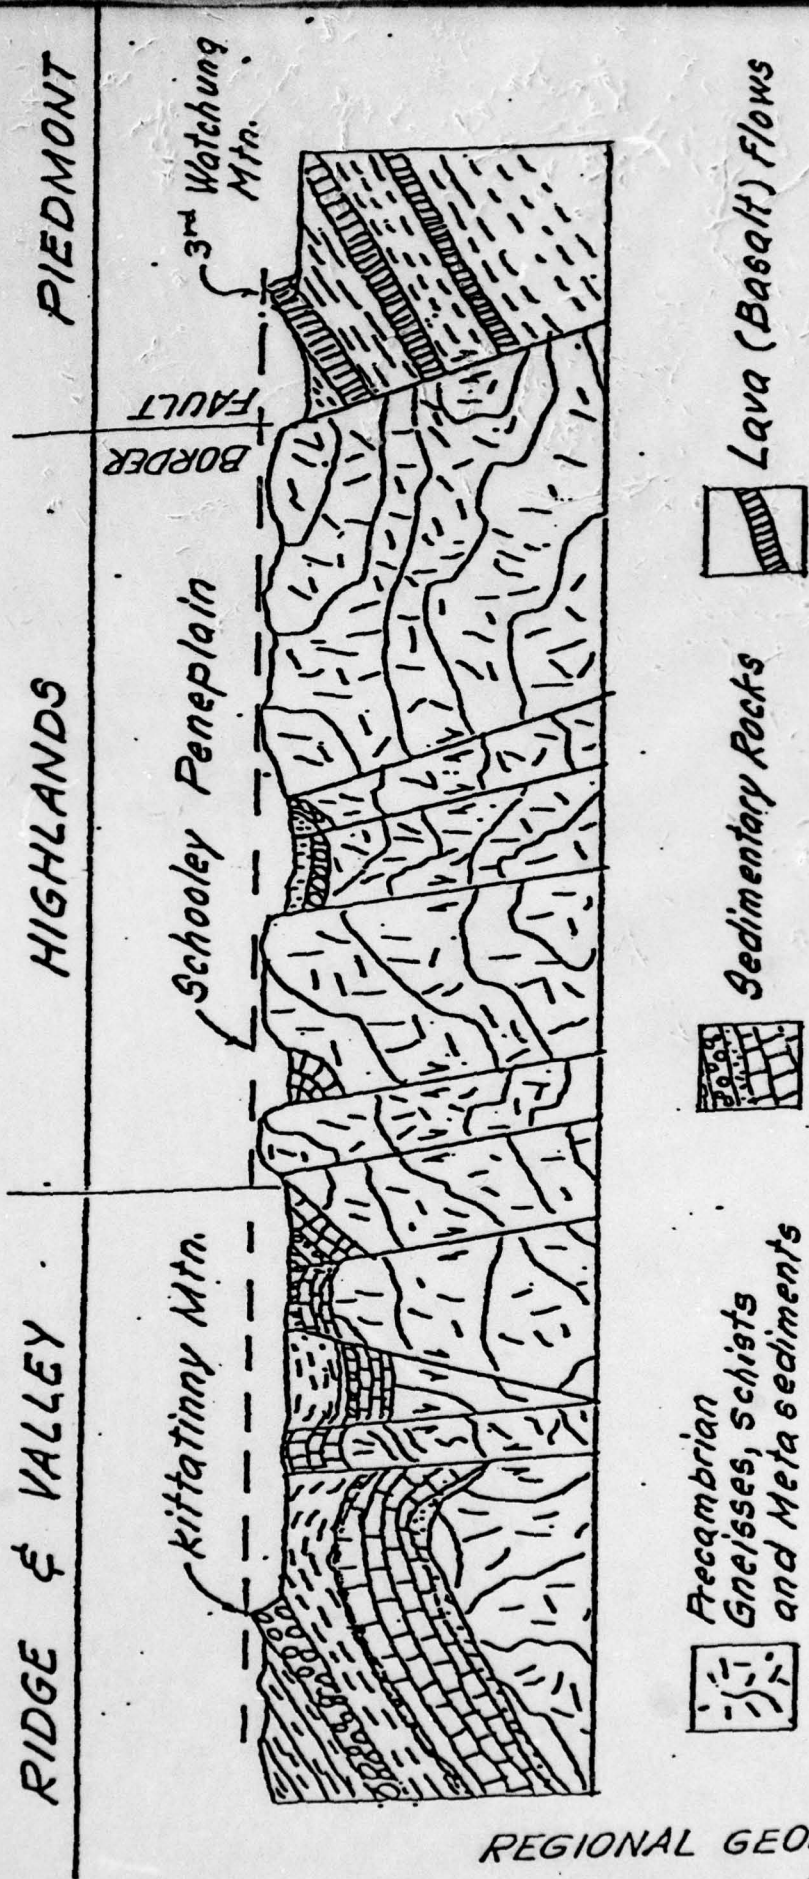

Schematic Cross-section of
Ridge & Valley
Physiographic Province
(After Wolfe, 1977)

APPENDIX 1

HISTORICAL SUMMARY

SWARTSWOOD LAKE DAM

KEENS MILL
SWARTSWOOD LAKE
STILLWATER TOWNSHIP
SUSSEX COUNTY, N.J.

(This historic summary is extracted from informations posted on the
bulletin board in front of the abandoned mill)

There has been a mill at the outlet to Swartswood Lake ever since the Revolutionary War. The first mill was erected by Charles Rhodes just prior to the end of the Revolutionary War. Charles Rhodes lived in a log cabin in Stillwater Township. He came to Sussex County from Monmouth County about 1779. He was forced to leave Monmouth County because of the constant raids by the British and Tories that occurred there between 1778 and 1782. He built a wooden mill at the outlet of Swartswood Lake where it empties into the present day mill brook. It is not certain if a dam was erected at this time. No description of the mill exists but we can assume it was the same type of mill that was built in other places in the county. It probably had a large wooden wheel that was turned by water power produced by the mill brook with a flume that directed the force of the water on to the wheel. Charles Rhodes had another mill in the area, a saw mill near Middleville on Trout Brook adjacent to the present day Stillwater Municipal building. Mr. Rhodes became Sussex County Clerk in 1783 and held that position until 1799 when he died. The mill was called The Rhodes Mill. Evidently, by the 1830's the mill fell into disrepair or it may even have been abandoned. The Keen family decided to build a more substantial mill some time in the late 1830's. This mill would be of hand-cut limestone and fieldstone. It is believed that the roof, as it is today, is original with the exception of the slate which may have been replaced over the years. The slate on the roof probably came from the slate mine outside of Newton on Ridge Road. The limestone was probably cut from nearby exposed limestone outcrops. The foundation of the mill is mostly set on bedrock that borders the mill brook.

The beams in the mill are mostly oak, cut from nearby properties. The window sashes are of ash also obtained from local sources. The original glass windows were in the mill until about 1965 when vandals smashed them; the owner of record, at that time, replaced them. Blair Academy assumed ownership some time in the late 1800's.

The dam, as it stands today, was built about 1905 or 1906; the previous dam was washed out in a spring freshet. The dam was replaced with a log-crib dam with very large stones to anchor it on the inside. The spillway portion had been open until just before Blair sold the property. They put a cement face on the dam wall to prevent the anchor stones from dislodging from within the log-crib portion as they had a tendency to do. On the corner of the mill facing the road to Swartswood is the date 1838, probably cut by the builder. There are other dates cut in the stones around the base of the mill believed to be "doodles" or passersby through the years.

The machinery in the mill has been removed. It is understood that the machinery was installed in the mill about 1895. There was a turbine located in the basement of the mill and had a large iron or steel shaft that went up into the mill proper that worked the grinding stones and the various other implements. At the time of installation, the shaft was bent and when the water was let in through the penstock tube that rotated the turbine it caused a great vibration all over the mill and threatened the destruction of the stones themselves. It is believed that the mill was sold to Blair Academy about that time. Blair was interested in the water of Swartswood Lake in order to maintain a sufficient amount of water to run their power station at Paulina. Blair also controlled the outlet of Fairview Lake; both bodies of water emptied into the Paulinskill River above Paulina.

The dam provided one of the best places to set eel fykes in all of Sussex County; people, at times, would fight to put their fyke in the dam or the old penstock tube. Just across the road from the old mill, the miller's house once stood but evidence of it has long since disappeared. It was possibly built on fieldstone. The interior walls of the mill were all plaster and never painted. Across the dam (over the bridge), according to one old resident, stood a one-room log schoolhouse. Part way up the hill on the old road that crosses the mountain there is evidence of old foundations and some plantings of the day or tiger lillies. Plantings of this flower are usually found around old home sites. Information about this school is not in any history book about Sussex County. The road across the dam has been unused for many years now; it was a township road. The township gave up the road and it became private; but still never used. It washed out badly and had deep ruts in it; it was used at a various times but only with a jeep.

But to return to the mill. Directly in front of the mill, there was an old road of sorts. Supposedly, the wagons with grain could drive up to below the pulley located in the center of the peak of the roof. In the upper story of the mill there was a long wooden shaft that was connected by belts to the main drive shaft and the farmers could have their grain brought inside via a rope or perhaps a platform. It has been said that all of the hardware in the mill was handmade by a blacksmith, as probably the nails were. The main beams are all wooden pegged. The years have taken a toll on the mill; dry rot has destroyed some of the largest beams. One corner, the one not anchored in bedrock, has sunk and disturbed one wall of the mill.

The State of New Jersey purchased the mill, dam and pond in 1976 and it is now part of Swartswood State Park.

At the present time, the interior of the mill is closed to the public.

APPENDIX 2

CHECK LIST

VISUAL INSPECTION

SWARTSWOOD LAKE DAM

CHECK LIST
VISUAL INSPECTION

Phase I

NAME DAM Swartswood Lake Dam COUNTY Sussex STATE New Jersey COORDINATORS N.J. DEP

DATE(s) INSPECTION See Below WEATHER Overcast & Cold TEMPERATURE 30° F

POOL ELEVATION AT TIME OF INSPECTION 481.71* M.S.L. TAILWATER AT TIME OF INSPECTION 472.5* M.S.L.

* Elevation reference to N.J. Geodetic Control Survey, Dept. of Conservation
BM Station 202 which exists on the right abutment (El. 484.47)

INSPECTION PERSONNEL:

J. Richards	<u>12/20/78</u>	J. Rizzo	<u>12/12/78</u>
P. Yu	<u>12/12/78</u> <u>12/20/78</u>	D. Leary	<u>12/20/78</u>
C. Campbell	<u>12/12/78</u>		

Peter Yu RECORDER

DOWNSTREAM CHANNEL

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
CONDITION (OBSTRUCTIONS, DEBRIS, ETC.)	Numerous fallen trees & debris across channel approx. 100' and 300' downstream from dam. Occasional fallen tree in between the two locations.	Fallen trees and debris should be removed.
SLOPES	1 Hor. to 1 Vert. on left bank. 3 Hor. to 1 Vert. on right bank. Bottom slopes of left bank appear to be washed and eroded, roots of trees exposed.	Eroded area should be suitably filled.
APPROXIMATE NO. OF HOMES AND POPULATION	No homes immediate downstream. Village of Stillwater, approx. 2½ miles downstream USGS Topo Map. Population est. about 150	

EARTHFILL GRAVITY DAM WITH MASONRY FACING

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
SEEPAGE ON LEAKAGE	None Observed	
STRUCTURE TO ABUTMENT/EMBANKMENT JUNCTIONS	Loose masonry on right and left abutment/embankment junction, downstream face. Erosion at right structure/abutment junction downstream face. Gullies as large as 1' wide 8" deep run down slope near N.E. corner of mill house.	Voids around masonry should be filled. Eroded area should be suitably filled.
DRAINS	None Observed	
WATER PASSAGES	None Observed	
FOUNDATION	Horizontal Hole 10" x 8" x 30" deep at toe of right side of dam downstream face.	Hole should be filled.

EARTHFILL GRAVITY DAM WITH MASONRY FACING

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
SURFACE CRACKS CONCRETE SURFACES	None observed other than cracks described below.	
STRUCTURAL CRACKING	Loose masonry on both ends of dam.	Voids around masonry should be filled.
VERTICAL AND HORIZONTAL ALIGNMENT	Appears satisfactory	
MONOLITH JOINTS	None Observed	
CONSTRUCTION JOINTS	Mortar cracks downstream face.	

OUTLET WORKS

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
CRACKING AND SPALLING OF CONCRETE SURFACES IN OUTLET CONDUIT	42"-dia. outlet pipe metal lining has rusted	The pipe does not appear in service at this time since the intake gate is surrounded by soil.
INTAKE STRUCTURE	Area in front of the intake gate structure filled.	Intake structure should be relocated or inlet channel be provided.
OUTLET STRUCTURE	Minor construction cracks on masonry surface.	
OUTLET CHANNEL	Leaves, wood logs, rusted structural steel obstructions.	Obstructions and debris should be removed.
EMERGENCY GATE	None observed	

RESERVOIR

VISUAL EXAMINATION OF	OBSERVATIONS	REMARK OR RECOMMENDATIONS
SLOPES	Appear satisfactory. Occasional vertical bulkhead from some home.	
SEDIMENTATION	Considerable amount of sediment (including leaves) deposited adjacent and up to spillway crest.	

UNGATED SPILLWAY

VISUAL EXAMINATION OF	OBSERVATIONS	REMARKS OR RECOMMENDATIONS
CONCRETE WEIR	Weir surface appears satisfactory. Right abutment wall slightly obstructs flow of water.	
APPROACH CHANNEL	Sediment in approach channel estimated to be high.	Investigate amount of sediment, remove if necessary.
DISCHARGE CHANNEL	Appears satisfactory	
BRIDGE AND PIERS	Wood bridge across top of dam appears satisfactory.	

APPENDIX 3

PHOTOGRAPHS

SWARTSWOOD LAKE DAM



Masonry rock face of dam.
Looking upstream.

20 December 1978



Abutments and roadway with wooden
bridge across dam. Looking west.


20 December 1978

SWARTSWOOD LAKE DAM



Left side of spillway discharge channel wall
and downstream face of dam. Looking east.

20 December 1978

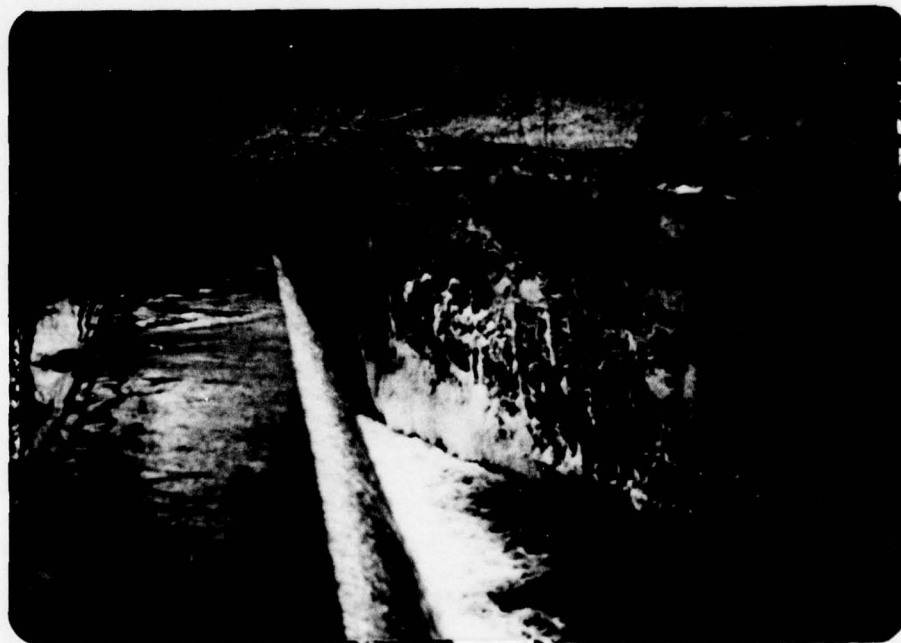

Crest of spillway and discharge channel
sidewall upstream of center of dam.
Looking east.

20 December 1978



Survey marker on right concrete abutment.
N.J. Geodetic Control Survey, Dept. of
Conservation BM Station 202.


20 December 1978



Right abutment and bridge. Note large tree
which is uplifting masonry. Looking west.

20 December 1978

SWARTSWOOD LAKE DAM

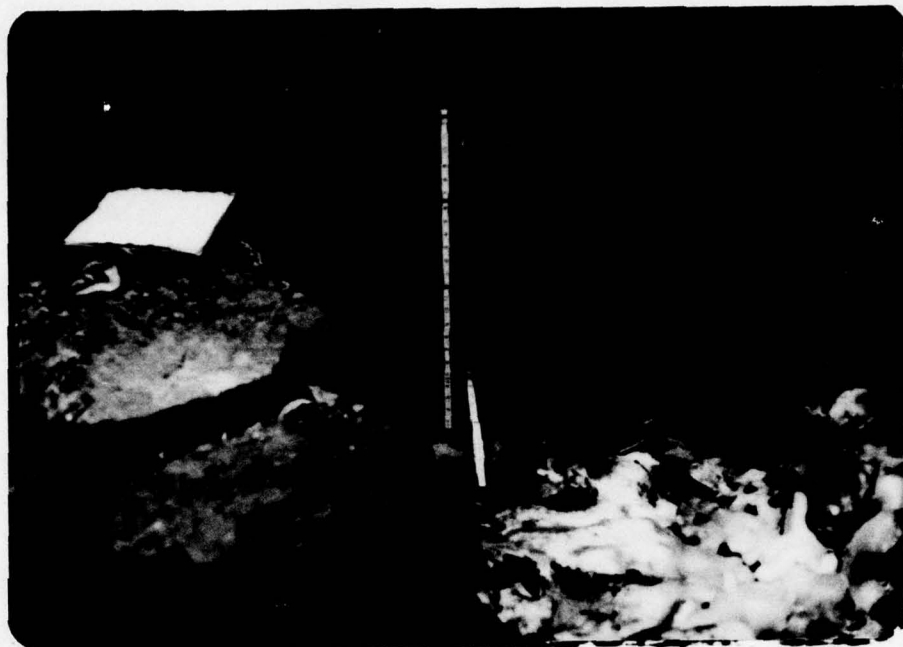

Openings at base of dam at right
downstream side of abutment.

20 December 1978



Erosion at downstream side of abutment.
(Historic Keens Mill House in background).

20 December 1978

SWARTSWOOD LAKE DAM



Gated 3.5-ft-dia low level outlet pipe
at downstream right face of dam.

20 December 1978



Trash rack and gate stem
no longer in use.


20 December 1978

SWARTSWOOD LAKE DAM



Deteriorated downstream face of masonry
of left abutment.

20 December 1978

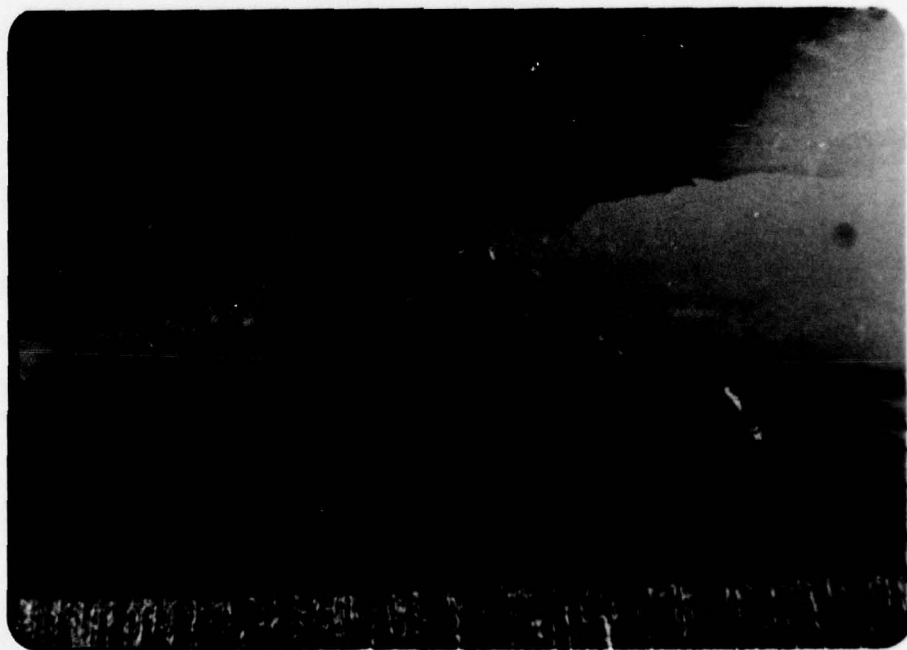

Debris upstream of spillway.

20 December 1978

SWARTSWOOD LAKE DAM



View of lake looking upstream from
wooden bridge.

20 December 1978



Downstream discharge channel.

20 December 1978

SWARTSWOOD LAKE DAM

APPENDIX 4

HYDROLOGIC COMPUTATIONS

SWARTSWOOD LAKE DAM

HYDROLOGIC COMPUTATIONSSWARTSWOOD LAKE DAMLocation : Sussex County, N.J.Drainage Area : 17.2 sq. mi.Lake Area : 516 Ac.Classification : size - Intermediate
hazard - significantSpillway Design Flood :In accordance with the evaluation criteria, $\frac{1}{2}$ PMF + PMF should be used. The PMF is chosenCOMPUTE PMF

1. Dam located in zone 1 (south boundary)
PMP = 22 inches
2. PMF must be adjusted for basin size (since dam locates close to zone 6, \therefore take average)

Duration	<u>% Factor (for 17.2 sq. mi)</u>			Reduction Factor
	<u>Zone 1</u>	<u>Zone 6</u>	<u>Average</u>	
0-6	106	108	107	0.81
0-12	118	118	118	
0-24	128	127	128	
0-48	137	138	138	

BY Dry DATE 2-26-79 Swartswood Lake DamJOB NO. J-783 BCKD SED DATE 4-18-79SHEET NO. 1 OF 8

Unit Hydrograph

Corp of Engineers has indicated that Snyder Method be used. The following coefficients are recommended:

$$C_t = 2.82, C_p = 0.62$$

Snyder Lag time

$$t_p = C_t (L \cdot L_{ca})^{0.3}$$

from drainage area

$$L = 45700 \text{ ft (8.65 mi)}$$

$$L_{ca} = 24200 \text{ ft (4.58 mi)}$$

$$\therefore t_p = 2.82 (8.65 \times 4.58)^{0.3}$$

$$= 8.50 \text{ hrs.}$$

$$C_p = 0.62$$




BY Py DATE 2-26-79 Sweetwood Lake Dam
 CKD [Signature] DATE 4-18-79


JOB NO. J-7836
 SHEET NO. 2 OF 8

SPILLWAY CAPACITY

Plan View:

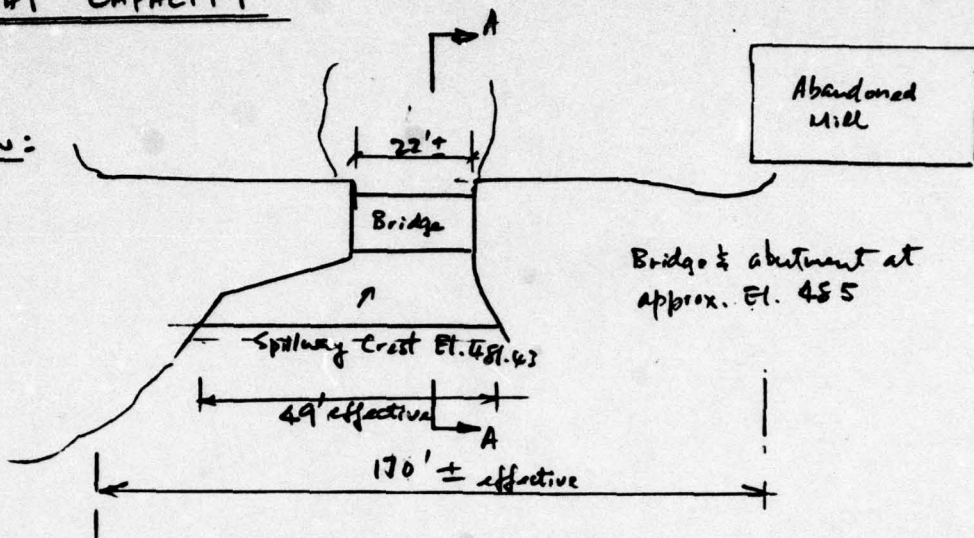

Section A-A:

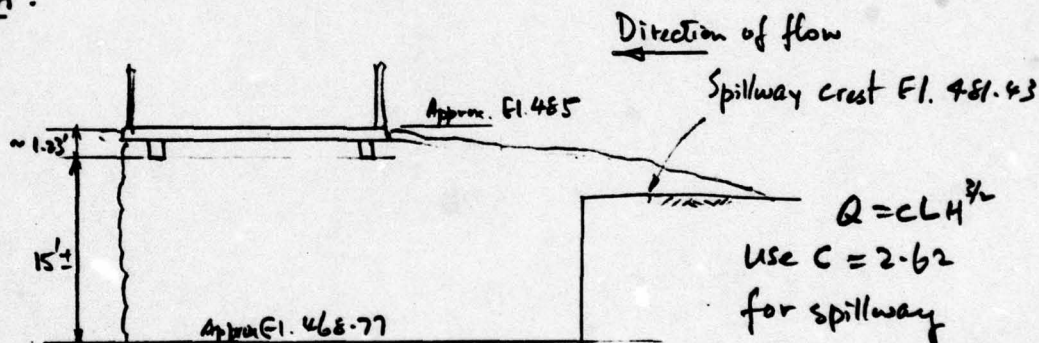

Outflow first discharges over spillway and flows through culvert under wood bridge. As water level rises to top of abutment (El. 485), $H = 485 - 481.43 = 3.57$ ft

$$\therefore Q = CLH^{3/2} = 2.62 \times 49 \times 3.57^{3/2} = 866 \text{ cfs}$$

At this time, tail water under bridge ≈ 3.85 ft
(from Fig 17-29 of 'open channel Hydraulics' by Chow)

\therefore culvert not filled yet.

As water level rises, outflow includes discharge over the 49'-spillway and discharge over abutment of 121' (= 170 - 49)

Abutment section similar to spillway section \therefore use $C = 2.62$

BY Dy DATE 2-27-79 Swartswood Lake Dam

JOB NO. J-783B

CKD GED DATE 4-18-79

SHEET NO. 3 OF 8

Spillway becomes submerged when tailwater rises to spillway crest. At this time, referring to Chow's book Fig 17.29,

$$d = 15, \quad H/d = 12.66/15 = 0.84$$

$$\% = 140 \quad \therefore Q = 3080 \text{ cfs}$$

\therefore head on spillway

$$= \left(\frac{Q}{C_L} \right)^{2/3} = \frac{3080}{2.62 \times 49} = 8.32 \text{ ft.}$$

\therefore submergence effect is very small.

Assume bridge fails as water rises to top of the deck (El. 485). At this time discharge over spillway continues to flow through bridge culvert section and over top of the abutment sections next to bridge. Assume effect of the obstruction produced by the left embankment to the discharge capacity of the spillway is insignificant, hence the discharge is continued to be governed by the spillway of 49 ft effective length.

Consider an additional outflow section of 50 feet when pool water is above El. 491 (See Fig 2 of report for approximate topography) Use $C = 2.5$

\therefore for spillway

$$Q_s = 2.62 \times 49 \times H^{3/2} = 128.38 H^{3/2}$$

for abutment section when pool above El 485

$$Q_{A1} = 2.62 \times 121 \times H^{3/2} = 317.02 H^{3/2}$$

for additional section when pool above El. 491


$$Q_{A2} = 2.5 \times 50 \times H^{3/2} = 125 H^{3/2}$$

Elevation vs Total Discharge

Elev. (ft)	Spillway		Abutment section when pool above E1485		Additional section when pool above E1491		Total Q_T (cfs) $= Q_1 + Q_{A1} + Q_{A2}$
	H (ft)	Q_s (cfs)	H (ft)	Q_{A1} (cfs)	H (ft)	Q_{A2} (cfs)	
481.43	0						0
482.43	1	128					128
483.43	2	363					363
484.43	3	667					667
485.0	3.57	866	0				866
486.0	4.57	1254	1	317			1571
487.0	5.57	1688	2	897			2585
488.0	6.57	2162	3	1647			3809
489.0	7.57	2674	4	2536			5210
490.0	8.57	3221	5	3544			6765
491.0	9.57	3861	6	4659	0		8460
492.0	10.57	4412	7	5871	1	125	10408
493.0	11.57	5052	8	7173	2	354	12579
494.0	12.57	5721	9	8560	3	650	14931
495.0	13.57	6418	10	10025	4	1000	17443
496.0	14.57	7140	11	11566	5	1398	20104
497.0	15.57	7887	12	13178	6	1837	22902

BY Py DATE 2-27-79 Shawtiwood Lake Dam
 CKD AED DATE 4-8-79

JOB NO. J-783 B
 SHEET NO. 5 OF 8

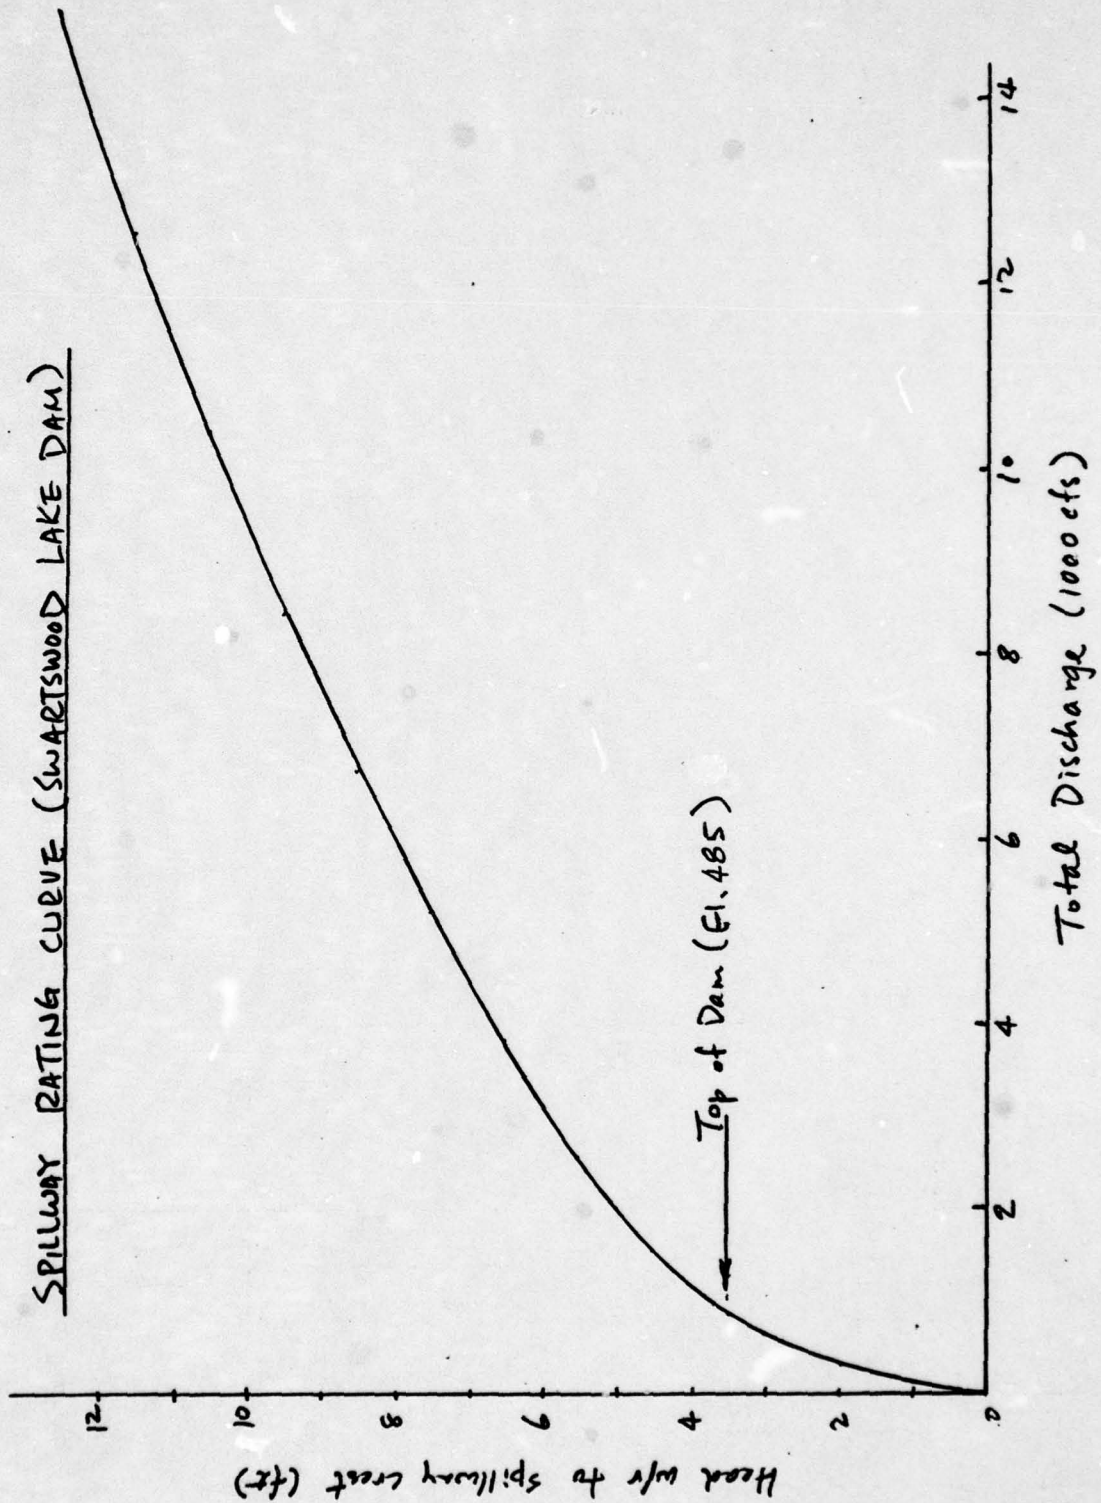

BY Py DATE 2-27-79 Swartswood Lake Dam
 CKD GED DATE 4-18-79

JOB NO. 7-783 B
 SHEET NO. 6 OF 8

Reservoir Storage Capacity

Assume a linear increase of the lake dimensions with elevation. Start at a zero storage at the crest of the spillway.

Area of Lake = 516 Ac.

Length of equivalent square = 4741 ft.

Take average side slope = 1V:5H.

∴ for every foot of water above the crest of spillway the length of equivalent square increases by
 $= 1 \times 5 \times 2 = 10 \text{ ft}$

Elev. (ft)	H (ft)	length of equivalent square (ft)	Area of Lake (Acres)
481.43	0	4741	516
483.43	2	4761	520
485.43	4	4781	525
487.43	6	4801	529
489.43	8	4821	534
491.43	10	4841	538
493.43	12	4861	542
495.43	14	4881	547
497.43	16	4901	551

Storage capacity vs. elevation to be calculated by HEC-1

BY Py DATE 2-27-79 Swainswood Lake Dam
 CKD GED DATE 4-18-79


JOB NO. J-763 B
 SHEET NO. 7 OF 1

SUMMARY OF HYDROGRAPH AND FLOOD ROUTING

1. Hydrograph and routing calculated using HEC-1
2. PMF peak inflow for Swatswood Lake is 14,755 cfs
(rounded to 11,607 cfs)
3. Routing indicates dam will overtop by approximately 7.5 ft. for PMF.

OVERTOPPING POTENTIAL

1. Various % of PMF has been routed using HEC-1
2. Plot peak outflow vs % PMF

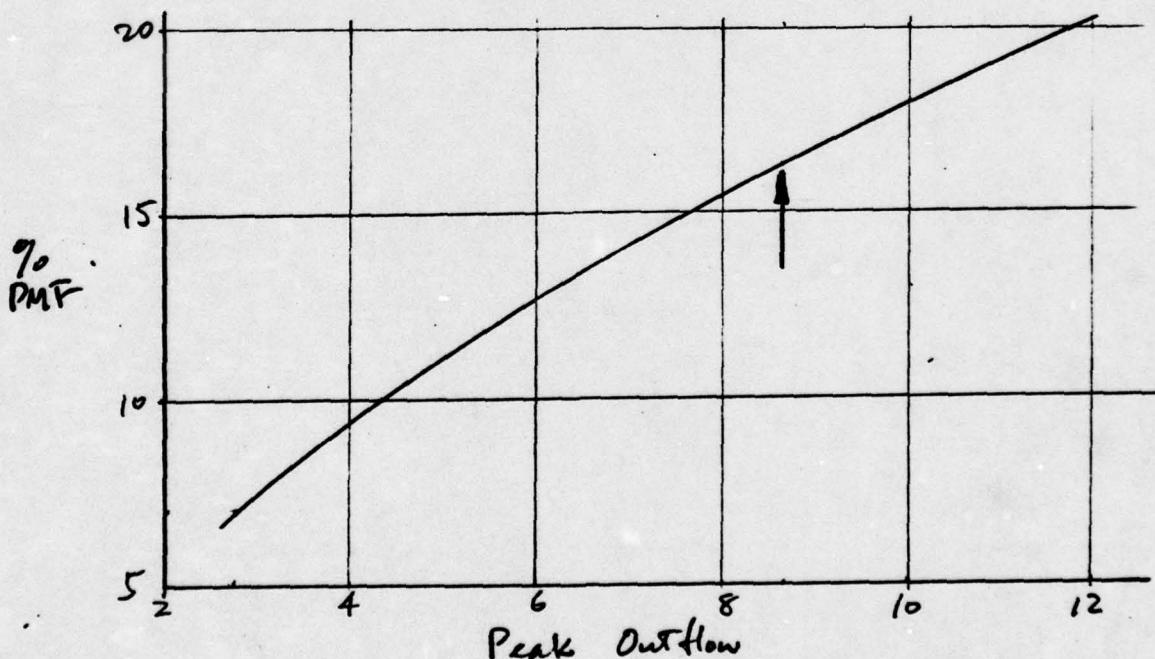

3. Dam overtops at approx. El. 485 with $Q = 866$ cfs
 \therefore dam can pass approx. 16 % of PMF.

BY py

DATE 2-27-79

Swatswood Lake Dam


JOB NO. J-783 B

SHEET NO. 8 OF 8

1





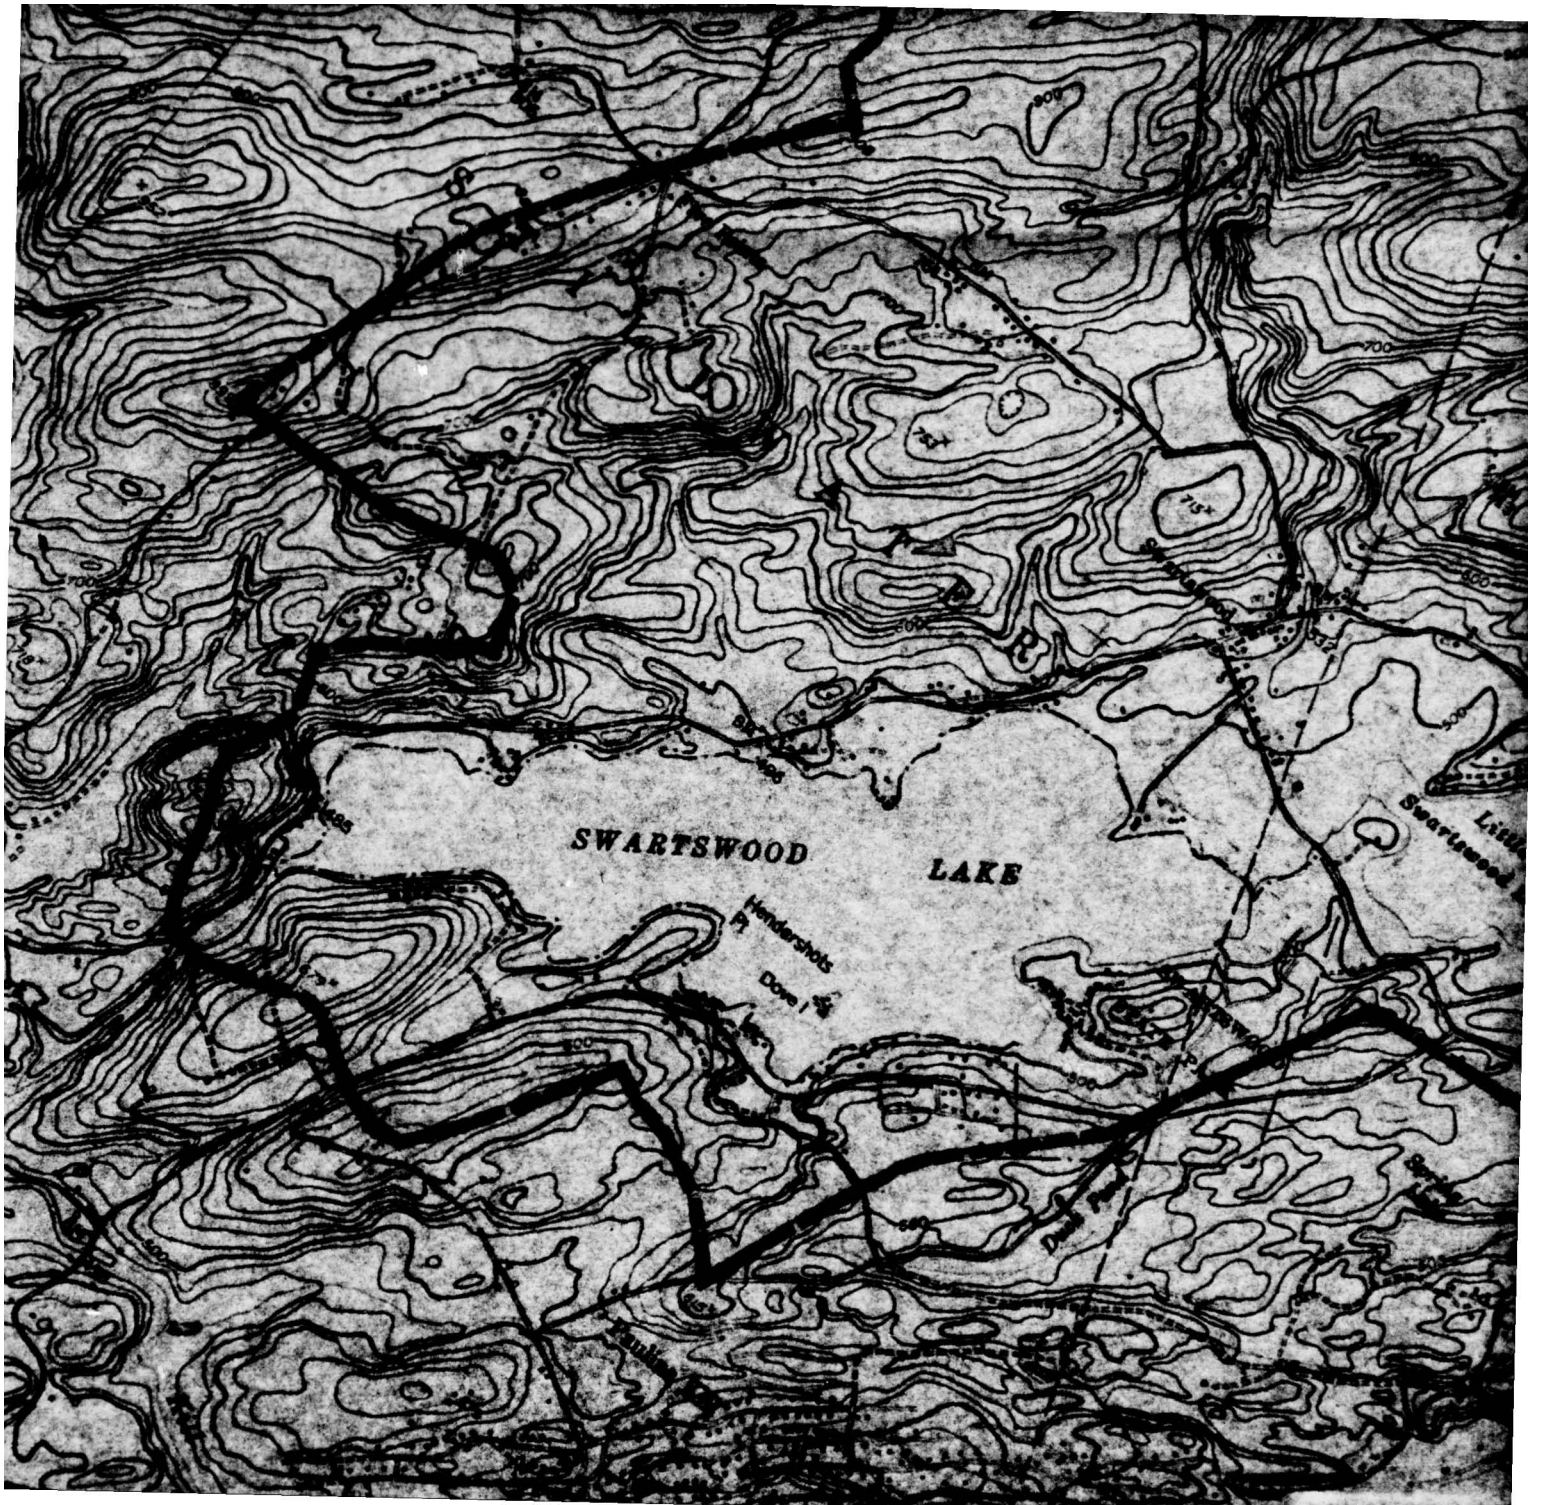



HEC-1 OUTPUT

SWARTSWOOD LAKE DAM

[illegible]

	1	2
RUNOFF HYDROGRAPH AT		
ROUTE HYDROGRAPH TO		
END OF NETWORK		

.....
 FLOW HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 11 JAN 79

RUN DATE 1/10/81
 TIME 13.52.53

SMARTSWOOD LAKE DAM
 INFLOW HYDROGRAPH AND ROUTING
 H.J. DAM INSPECTION

NO	KHR	NMIN	IDAY	JOR	SPECIFICATION	METRC	IPLI	IPRI	NSTAN
150	1	0	0	0	IMIN	0	0	0	0
			JOPER	0	LROPT	TRACE			
			3	0	0				

.....
 SUB-AREA RUNOFF COMPUTATION

COMPUTE HYDROGRAPH

ISTAQ	ICOMP	IECON	ITAPF	JPLI	JPRI	INAME	ISTAGE	IAUTO
1	0	0	0	0	0	1	0	0

IMVDS	IUNG	IAREA	SNAP	TRSDA	TRSPC	RATIO	ISNOJ	ISAME	LOCAL
1	1	17.20	0.00	17.20	.81	0.000	0	0	0

SPFF	PMS	R5	R6	R72	R96
0.00	22.00	107.00	118.00	128.00	138.00

LOSS DATA	PRECIP DATA
STKRS	R12
0.00	0.00

UNIT HYDROGRAPH DATA	NTA=
IP= 8.50	CP= .62

APPROXIMATE CLARK COEFFICIENTS FROM GIVEN SNYDER C₀ AND TP ARF TC= 9.62 RITOR= 1.00 HOURS, CP= .62 VOL= 1.00

UNIT HYDROGRAPH	47	END-OF-PERIOD	ORDINATES	LAG=	R.44	HOURS	CP=	79H.
31:	117:	23:	513:	648:	749:	334:	91:	228:
717:	631:	489:	431:	379:	334:	294:	82:	64:
200:	176:	137:	120:	106:	91:	72:	20:	18:
56:	49:	38:	34:	30:	26:	23:		
16:	12:	11:	9:	8:	7:			

MO.DA	HR.MN	PERIOD	RAIN	EXCS	LOSS	END-OF-PERIOD FLOW	MO.DA	HR.MN	PERIOD	RAIN	EXCS	LOSS	COMP. 0
1.01	1.00	1	.01	0.00	.01	1.04	4.00	75	0.00	0.00	0.00	0.00	517:
1.01	2.00	2	.01	0.00	.01	1.04	4.00	77	0.00	0.00	0.00	0.00	457:
1.01	3.00	3	.01	0.00	.01	1.04	4.00	78	0.00	0.00	0.00	0.00	457:

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....
.....
.....

.....

.....

.....

.....

.....

HYDROGRAPH ROUTING

.....

.....

.....

.....

.....

DAM DATA		DAMWID
COOD	EXFO	
0.0	0.0	0.0
TOPEL		
485.0		

[illegible]

.....
.....
.....
.....

.....
.....
.....
.....

.....
.....
.....
.....

.....
.....
.....
.....

.....
.....
.....
.....

.....
.....

.....
.....
.....
.....

.....
.....
.....
.....

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100 101 102 103 104 105 106 107 108 109 110 111 112 113 114 115 116 117 118 119 120 121 122 123 124 125 126 127 128 129 130 131 132 133 134 135 136 137 138 139 140 141 142 143 144 145 146 147 148 149 150 151 152 153 154 155 156 157 158 159 160 161 162 163 164 165 166 167 168 169 170 171 172 173 174 175 176 177 178 179 180 181 182 183 184 185 186 187 188 189 190 191 192 193 194 195 196 197 198 199 200 201 202 203 204 205 206 207 208 209 210 211 212 213 214 215 216 217 218 219 220 221 222 223 224 225 226 227 228 229 230 231 232 233 234 235 236 237 238 239 240 241 242 243 244 245 246 247 248 249 250 251 252 253 254 255 256 257 258 259 260 261 262 263 264 265 266 267 268 269 270 271 272 273 274 275 276 277 278 279 280 281 282 283 284 285 286 287 288 289 290 291 292 293 294 295 296 297 298 299 300 301 302 303 304 305 306 307 308 309 310 311 312 313 314 315 316 317 318 319 320 321 322 323 324 325 326 327 328 329 330 331 332 333 334 335 336 337 338 339 340 341 342 343 344 345 346 347 348 349 350 351 352 353 354 355 356 357 358 359 360 361 362 363 364 365 366 367 368 369 370 371 372 373 374 375 376 377 378 379 380 381 382 383 384 385 386 387 388 389 390 391 392 393 394 395 396 397 398 399 400 401 402 403 404 405 406 407 408 409 410 411 412 413 414 415 416 417 418 419 420 421 422 423 424 425 426 427 428 429 430 431 432 433 434 435 436 437 438 439 440 441 442 443 444 445 446 447 448 449 450 451 452 453 454 455 456 457 458 459 460 461 462 463 464 465 466 467 468 469 470 471 472 473 474 475 476 477 478 479 480 481 482 483 484 485 486 487 488 489 490 491 492 493 494 495 496 497 498 499 500 501 502 503 504 505 506 507 508 509 510 511 512 513 514 515 516 517 518 519 520 521 522 523 524 525 526 527 528 529 530 531 532 533 534 535 536 537 538 539 540 541 542 543 544 545 546 547 548 549 550 551 552 553 554 555 556 557 558 559 560 561 562 563 564 565 566 567 568 569 570 571 572 573 574 575 576 577 578 579 580 581 582 583 584 585 586 587 588 589 590 591 592 593 594 595 596 597 598 599 600 601 602 603 604 605 606 607 608 609 610 611 612 613 614 615 616 617 618 619 620 621 622 623 624 625 626 627 628 629 630 631 632 633 634 635 636 637 638 639 640 641 642 643 644 645 646 647 648 649 650 651 652 653 654 655 656 657 658 659 660 661 662 663 664 665 666 667 668 669 670 671 672 673 674 675 676 677 678 679 680 681 682 683 684 685 686 687 688 689 690 691 692 693 694 695 696 697 698 699 700 701 702 703 704 705 706 707 708 709 710 711 712 713 714 715 716 717 718 719 720 721 722 723 724 725 726 727 728 729 730 731 732 733 734 735 736 737 738 739 740 741 742 743 744 745 746 747 748 749 750 751 752 753 754 755 756 757 758 759 760 761 762 763 764 765 766 767 768 769 770 771 772 773 774 775 776 777 778 779 780 781 782 783 784 785 786 787 788 789 790 791 792 793 794 795 796 797 798 799 800 801 802 803 804 805 806 807 808 809 810 811 812 813 814 815 816 817 818 819 820 821 822 823 824 825 826 827 828 829 830 831 832 833 834 835 836 837 838 839 840 841 842 843 844 845 846 847 848 849 850 851 852 853 854 855 856 857 858 859 860 861 862 863 864 865 866 867 868 869 870 871 872 873 874 875 876 877 878 879 880 881 882 883 884 885 886 887 888 889 890 891 892 893 894 895 896 897 898 899 900 901 902 903 904 905 906 907 908 909 910 911 912 913 914 915 916 917 918 919 920 921 922 923 924 925 926 927 928 929 930 931 932 933 934 935 936 937 938 939 940 941 942 943 944 945 946 947 948 949 950 951 952 953 954 955 956 957 958 959 960 961 962 963 964 965 966 967 968 969 970 971 972 973 974 975 976 977 978 979 980 981 982 983 984 985 986 987 988 989 990 991 992 993 994 995 996 997 998 999 1000 1001 1002 1003 1004 1005 1006 1007 1008 1009 1010 1011 1012 1013 1014 1015 1016 1017 1018 1019 1020 1021 1022 1023 1024 1025 1026 1027 1028 1029 1030 1031 1032 1033 1034 1035 1036 1037 1038 1039 104

7
772.3
482.2

725.
419.

107.
104.

32.
34.

148 149.00
148 149.00
130 150.00

1.37 5.00
1.37 5.00
1.07 6.00

PEAK CUMULATIVE IS 11607. AT TIME 51.00 HOURS

CFR	CHS	INCHES	AC-FT	THOUS CU M
PEAK	11607.			
325.				
6-HOUR	10923.			
24-HOUR	7081.			
72-HOUR	2921.			
TOTAL VOLUME	217693.			
	6164.			
	19.62			
	498.41			
	17991.			
	22192.			

KURDOFF SUMMARY, AVERAGE FLOW IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

	PEAK	6-HOUR	24-HOUR	72-HOUR	AREA
HYDROGRAPH AT	1, 14755;	13763;	8082;	3066;	17.20
	(417.82);	(389.74);	(228.85);	(86.55);	(44.55)
ROUTED TO	2, 11607;	10923;	7081;	2921;	17.20
	(328.66);	(309.30);	(200.52);	(82.72);	(44.55)

SUMMARY OF DAM SAFETY ANALYSIS

FLASH I	ELEVATION STORAGE OUTFLOW	INITIAL VALUE 481.43 0. 0.	SPILLWAY CREST 481.43 0. 0.	TOP OF DAM 485.00 1855. 866.	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
RATIO OF PMF 0.00	MAXIMUM RESERVOIR W.S.ELEV 492.55	MAXIMUM DEPTH OVER DAM 7.55	MAXIMUM STORAGE AC-FT 5875.	MAXIMUM OUTFLOW CFS 11607.	39.00	51.00	0.00

.....
 FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 11 JAN 79

9

1	2
RUNOFF HYDROGRAPH AT	
ROUTE HYDROGRAPH TO	
END OF NETWORK	

.....
 FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 11 JAN 79

RUN DATE# 79/03/11
 TIME# 14.26.59.

SWARTWOOD LAKE DAM
 X PMF
 N.J. DAM INSPECTION

NO	NHR	IMIN	IOAY	JOB SPECIFICATION	METRC	IPLI	IPRT	NSTAN
150	1	0	0	IHK IMIN	0	0	4	0
			JOPER	NWT LKOPT	TRACE			
			5	0	0			

MULTI-PLAN ANALYSES TO BE PERFORMED
 NPLAN= 1 NR10= 6 LRTIO= 1
 RTIOS= 1.00 .50 .20 .10 .07 .04

.....

SUB-AREA RUNOFF COMPUTATION

COMPUTE HYDROGRAPH

ISTAQ	ICOMP	IECON	ITAPE	JPLT	JPRT	INAME	ISTAGE	IAUTO
1	0	0	0	0	0	1	0	0

IHYDC	IUNG	IAMEA	SNAP	HYDROGRAPH DATA	RATIO	ISHOW	ISAME	LOCAL
1	1	17.23	0.00	TRSDA TRSPC	0.000	0	0	0
				17.20	.81			

SPFE	PMS	R6	R12	R24	R48	R72	R96
0.00	22.00	107.00	118.00	128.00	138.00	0.00	0.00

LKOPT	SIRK	FLIKR	RIIOL	ERAIN	SIRKS	RIIOK	SIRIL	CNSIL	ALSMX	RIIAP
0.00	0.00	0.00	1.00	0.00	0.30	1.00	1.00	.15	0.00	0.00

PRECIP DATA
 LOSS DATA
 UNIT HYDROGRAPH DATA
 TP= 8.50 CP= .62 NTA= 0

RECESSION DATA
 STRTU= -2.00 GRCSN= 0.00 RTIOR= 1.00

UNIT HYDROGRAPH	47	END-OF-PERIOD	ORDINATES	LAG=	P-44	HOURS	CP=	VOL=
31.	117.	215.	513.	648.	749.	832.	811.	1.00
717.	631.	536.	431.	379.	334.	269.	284.	832.
236.	176.	155.	126.	106.	93.	272.	82.	259.
56.	49.	43.	34.	30.	29.	20.	25.	20.
16.	14.	12.	9.	8.				

MO.DA HR.MN PERIOD RAIN EXCS LACS END-OF-PERIOD FLOW MO.DA HR.MN PERIOD RAIN EXCS LACS

PEAK FLOW AND STORAGE (FLOOD OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIO	RATIOS APPLIED TO FLOWS					
					RATIO	RATIO	RATIO	RATIO	RATIO	RATIO
				1.00	.50	.20	.10	.07	.04	.04
HYDROGRAPH AT	1	17.20	1	14755	7378	2951	1476	1033	590	590
	(44.55)	(417.82)	208.91)	83.56)	41.78)	29.25)	16.71)	16.71)
ROUTED TO	2	17.20	1	11607	4796	1177	435	274	125	125
	(44.55)	(328.66)	135.65)	33.34)	12.32)	7.77)	3.53)	3.53)

SUMMARY OF DAM SAFETY ANALYSIS

13

PLAN 1	ELEVATION STORAGE OUTFLOW	INITIAL VALUE 481.43 0. 0.	SPILLWAY CREST 481.43 0. 0.	TOP OF DAM 485.00 1855. 866.	TIME OF FAILURE HOURS
RATIO OF PHF	MAXIMUM RESERVOIR W.S.-FLEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	TIME OF MAX OUTFLOW HOURS
1.00	482.55	7.55	5875.	11607.	51.00
.20	488.78	3.70	3809.	14700.	53.00
.10	485.44	.44	2087.	1177.	56.00
.07	483.67	0.00	1159.	435.	59.00
.04	483.05	0.00	840.	274.	60.00
	482.41	0.00	505.	125.	61.00

.....
 FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 11 JAN 79

APPENDIX 5

REFERENCES

SWARTSWOOD LAKE DAM

APPENDIX 5

REFERENCES

SWARTSWOOD LAKE DAM

1. Brater, Ernest F. and Kings, Horace W. Handbook of Hydraulics 5th Edition, McGraw-Hill Book Company 1963.
2. Chow, Ven Te, Ph.D, Open Channel Hydraulics, McGraw-Hill Book Company, 1959.
3. Eby, C.F., 1976 Soil Survey of Morris County, New Jersey, U.S. Department of Agriculture, Soil Conservation Service, 111 pp.
4. Lewis, J.V., and H.B. Kummel, 1924, The Geology of New Jersey Bulletin 14, Geological Survey of New Jersey, Trenton, New Jersey, 146 pp.
5. United States Dept. of Agriculture, Soil Conservation Service SCS National Engineering Handbook Section 4 Hydrology NEH-Notice 4-102, August 1972.
6. United States Dept. of Agriculture, Soil Conservation Service, Somerset, N.J. Urban Hydrology for Small Watersheds, Technical Release No. 55, January 1975.
7. United States Department of Commerce Weather Bureau, Hydrometeorological Report No. 33, Washington, D.C. April 1956.
8. United States Dept. of Interior, Bureau of Reclamation Design of Small Dams, Second Edition 1973, Revised Print 1977.
9. Widmer, K., 1964, The Geology and Geography of New Jersey, Volume 19, The New Jersey Historical Series, D. Van Nostrand Co., Inc., Princeton, New Jersey 193 pp.
10. Wolfe, P.E., 1977, The Geology and Landscapes of New Jersey, Crane, Russak & Company, Inc., New York, New York, 351 pp.
11. Letter to Charles P. Wilbur, Director, Div. of Forestry, Geology, Parks & Historic Sites, from H.T. Critchlow, dated 8 November 1948.
12. Letter to Robert L. Hardman, Bureau of Water Control from David Reppa, dated 4 August 1971.
13. Letter to David Reppa from Robert L. Hardman, Ass't Director, Bureau of Water Control, dated 17 August 1971.
14. Report on Dam Inspection, by Norman C. Wittwer, Principal Hydraulic Engineer, dated 8 November 1948.
15. Reference Data, by Norman C. Wittwer, dated 3 November 1948.